| APP CRS | Rwy Ldg | 10114 |
|---|---|---|
| 281° | TDZE | 815 |
| | Apt Elev | 815 |

# RNAV (RNP) Z RWY 28L

JOHN GLENN COLUMBUS INTL (CMH)


RNP AR APCH.

For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.30 all Cats visibility to 1⅜ SM. Simultaneous approach authorized.


MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BOUTN LOM and hold.


| D-ATIS | COLUMBUS APP CON | COLUMBUS TOWER | GND CON |
|---|---|---|---|
| 124.6 | 125.95 371.975 | 132.7 257.8 | 121.9 348.6 |

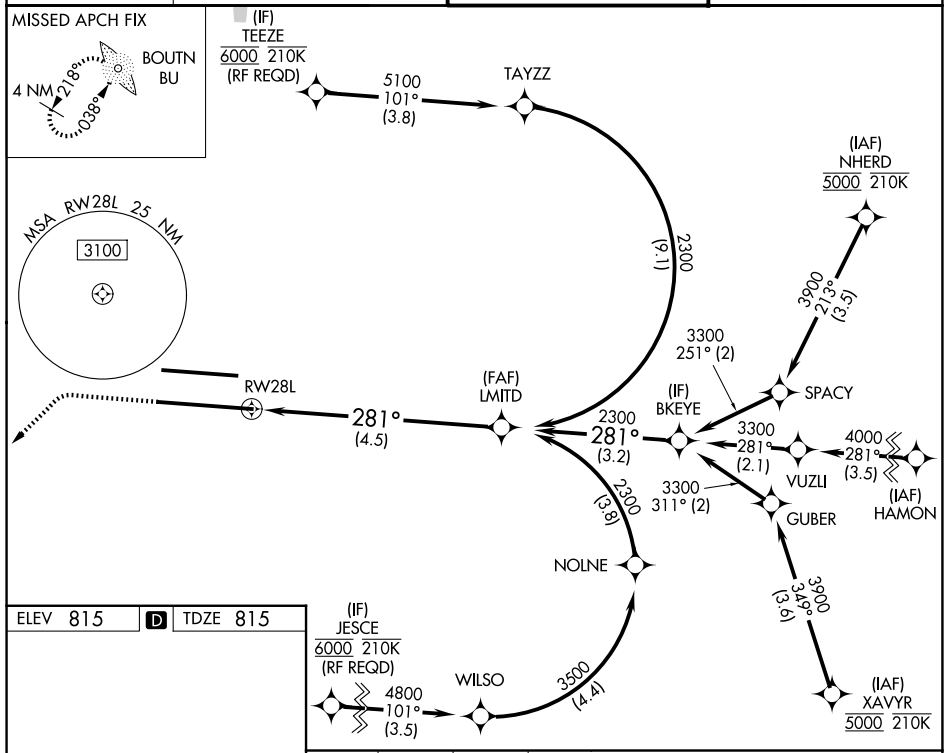


ELEV 815 D TDZE 815

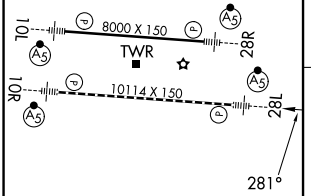


TDZL/RCLS Rwy 10R-28L
HIRL Rwys 10R-28L and 10L-28R

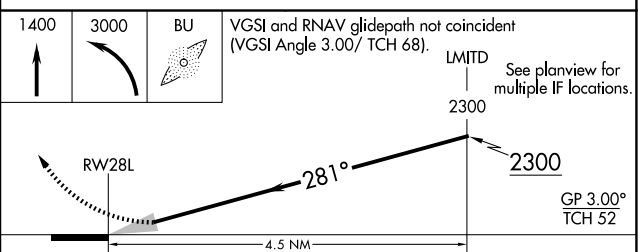


| CATEGORY | A | B | C | D |
|---|---|---|---|---|
| RNP 0.17 DA | 1147/26 | 332 (400-½) | | |
| RNP 0.30 DA | 1314/50 | 499 (500-1) | | |

## AUTHORIZATION REQUIRED



EC-2, 29 OCT 2026 to 26 NOV 2026
EC-2, 29 OCT 2026 to 26 NOV 2026