ILS or LOC RWY 30

MIAMI INTL (MIA)


LOC/DME I-DCX	APP CRS	Rwy Ldg	7913
111.7	304°	TDZE	8
Chan 54		Apt Elev	9

DME required.
Inop table does not apply.

MALS

MISSED APPROACH: Climb to 800 then climbing right turn to 2000 on heading 310° and DHP VORTAC R-335 to BRBRA/11.5 DME and hold.

D-ATIS	MIAMI APP CON	MIAMI TOWER	GND CON	
119.15	124.85 322.3	118.3 256.9	121.8 (8L/8R/12/26L/26R) 127.5 (9/27/30)	348.6

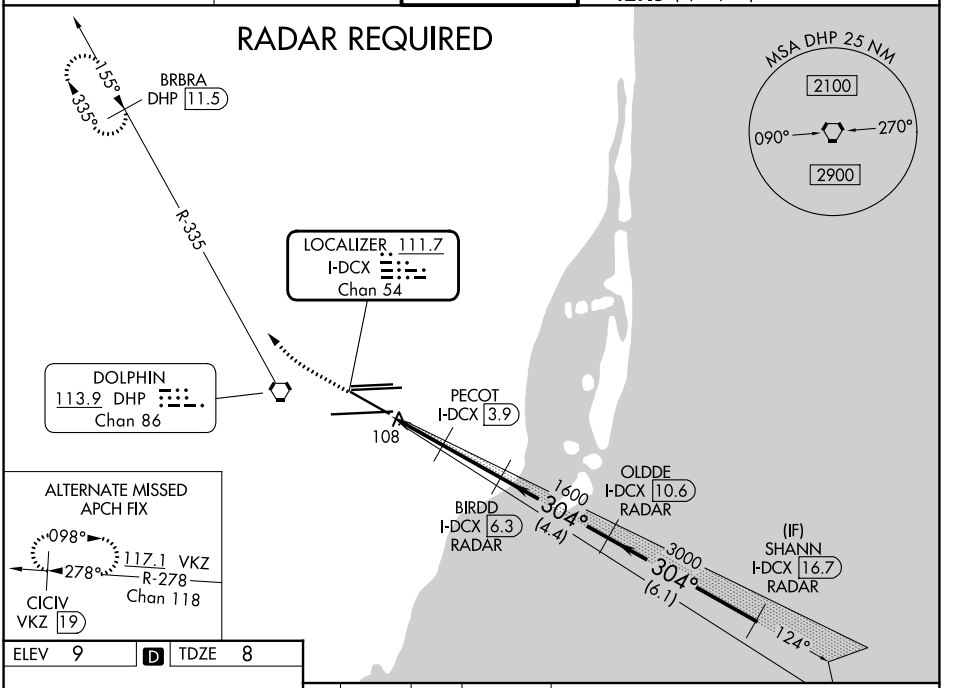


ELEV 9	D	TDZE 8


800	2000 hdg 310°	DHP R-335	BRBRA DHP 11.5

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 71).

*LOC only.

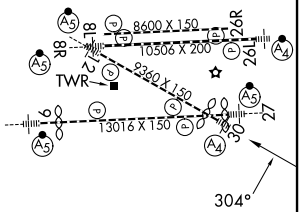

TDZ/CL Rwy 8R
REIL Rwys 8L and 26R
HIRL all Rwys

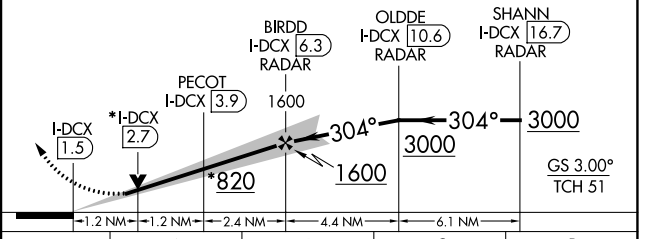

CATEGORY	A	B	C	D
S-ILS 30	258/40	250 (300-¾)		
S-LOC 30	460/40	452 (500-¾)	460/60 452 (500-1¼)	460-1½ 452 (500-1½)

FAF to MAP 4.8 NM

Knots	60	90	120	150	180
Min:Sec	4:48	3:12	2:24	1:55	1:36

SE-3, 29 OCT 2026 to 26 NOV 2026
SE-3, 29 OCT 2026 to 26 NOV 2026