RNAV (GPS) Z RWY 30

MIAMI INTL (MIA)

WAAS CH 40105 W30A	APP CRS 305°	Rwy Ldg 7913 / TDZE 9 / Apt Elev 9

RNP APCH - GPS.


Inop table does not apply to LNAV Cat C and D.
For inop ALS, increase LPV all Cats visibility to RVR 4500.

MALS

MISSED APPROACH: Climb to 3000 direct IPFAH and on 329° track to BRBRA and hold.


D-ATIS	MIAMI APP CON	MIAMI TOWER	GND CON
119.15	124.85 322.3	118.3 256.9	121.8 (8L/8R/12/26L/26R) 127.5 (9/27/30) 348.6

MISSED APCH FIX




Procedure NA for arrivals at HILEY on V295 northbound.

ELEV 9 | D | TDZE 9

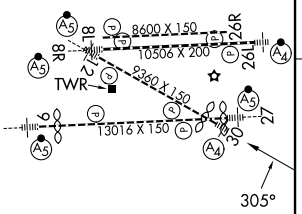

3000	IPFAH	tr 329°	BRBRA

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).

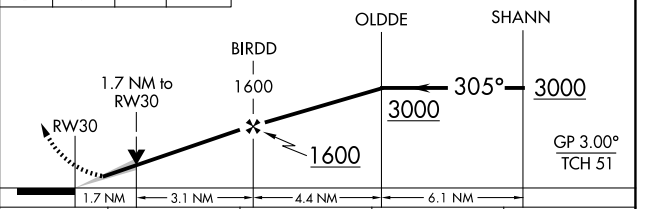

CATEGORY	A	B	C	D
LPV DA	286/40		277 (300-¾)	
LNAV MDA	620/40	611 (700-¾)	620-1½	611 (700-1½)

TDZ/CL Rwy 8R
REIL Rwys 8L and 26R
HIRL all Rwys

SE-3, 29 OCT 2026 to 26 NOV 2026
SE-3, 29 OCT 2026 to 26 NOV 2026