VOR RWY 34

RICHMOND INTL (RIC)

VORTAC RIC	APP CRS	Rwy Ldg	9003
114.1	323°	TDZE	161
Chan 88		Apt Elev	167


DME or RADAR required. RADAR required for procedure entry.

For inop ALS, increase S-34 Cat C/D visibility to RVR 5500.


ALSF-2

MISSED APPROACH: Climbing right turn to 2000 via RIC R-018 to EPICS INT and hold.

ATIS	POTOMAC APP CON	RICHMOND TOWER	GND CON
119.15 263.025	126.4 282.375 (001°-185°) 126.75 307.2 (186°-360°)	121.1 257.8	121.9 348.6

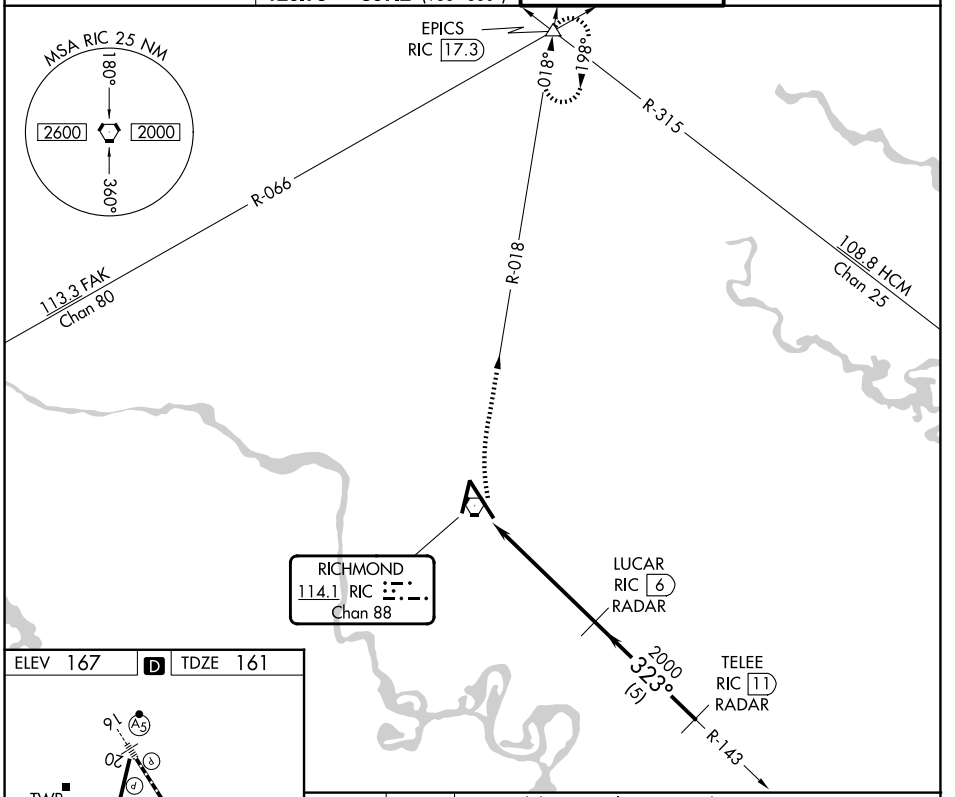

ELEV 167 D TDZE 161

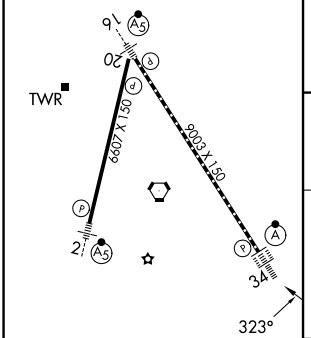


TDZ/CL Rwy 34
HIRL Rwys 2-20 and 16-34
REIL Rwy 20

FAF to MAP 5.3 NM

Knots	60	90	120	150	180
Min:Sec	5:18	3:32	2:39	2:07	1:46

2000 RIC R-018 EPICS

VGSI and descent angles not coincident (VGSI Angle 3/00/TCH 79).

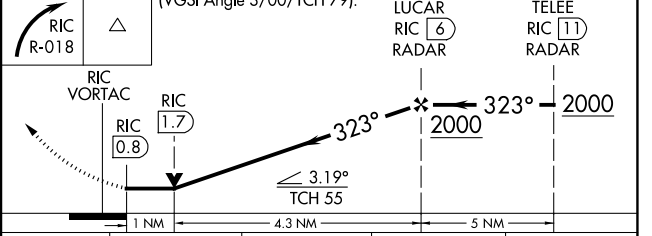

CATEGORY	A	B	C	D
S-34	540/24 379 (400-½)		540/40 379 (400-¾)	540/50 379 (400-1)
CIRCLING	660-1 493 (500-1)		700-1½ 533 (600-1½)	720-2 553 (600-2)

NE-3, 29 OCT 2026 to 26 NOV 2026
NE-3, 29 OCT 2026 to 26 NOV 2026