APP CRS		
306°	Rwy Ldg	7614
	TDZE	57
	Apt Elev	62

RNAV (RNP) Z RWY 30L

MINETA SAN JOSE INTL (SJC)


RNP AR APCH.

T For uncompensated Baro-VNAV systems, procedure NA below 1°C or above 54°C . For inop ALS, increase RNP 0.10 all Cats visibility to RVR 5500 and increase RNP 0.30 all Cats visibility to 1⅜ SM.


MALSR

MISSED APPROACH: Climb to 2000 on track 306° to ARTAQ and hold.

D-ATIS	NORCAL APP CON	SAN JOSE TOWER ★	GND CON	UNICOM
126.95	120.1 290.25	124.0 (CTAF) L 257.6	121.7	122.95

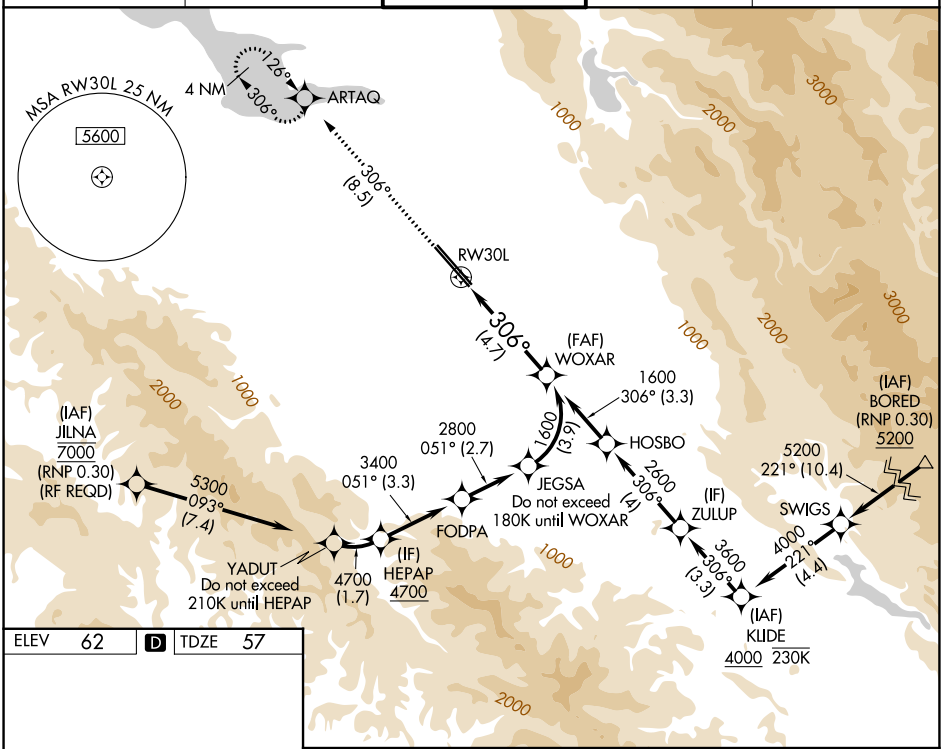

ELEV	62	D	TDZE	57

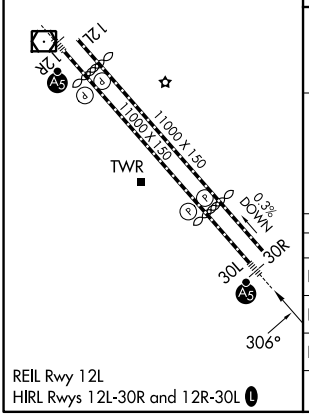


REIL Rwy 12L
HIRL Rwys 12L-30R and 12R-30L L

2000 tr 306° ARTAQ

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 70).

See planview for multiple IF locations.

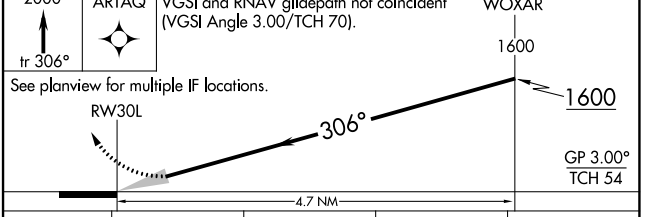

CATEGORY	A	B	C	D
RNP 0.10 DA		430/35	373 (400-⅝)	
RNP 0.20 DA		464/40	407 (500-¾)	
RNP 0.30 DA		541/50	484 (500-1)	

AUTHORIZATION REQUIRED

SW-2, 29 OCT 2026 to 26 NOV 2026
SW-2, 29 OCT 2026 to 26 NOV 2026