VOR RWY 36

DECATUR (DEC)

VORTAC AXC	APP CRS	Rwy Ldg 5298
117.2 Chan 119	348°	TDZE 678
		Apt Elev 682


DME required.

Rwy 36 helicopter visibility reduction below ¾ NA. When local altimeter setting not received, use Lincoln altimeter setting and increase all MDA 80 feet, increase S-36 Cat C/D and Circling Cat C/D visibility ¼ SM. VDP NA when using Lincoln altimeter setting.

MISSED APPROACH: Climb to 3100 on AXC VORTAC R-348 to MAROA INT/AXC 14.3 DME and hold.

ATIS	CHAMPAIGN APP CON ★	DECATUR TOWER ★	GND CON	UNICOM
126.35	132.85 290.225	118.9 (CTAF) L 291.775	121.75 291.775	122.95

MISSED APCH FIX

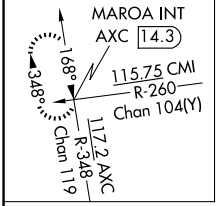

CATEGORY	A	B	C	D
S-36	1160-1 482 (500-1)		1160-1⅜	482 (500-1⅜)
CIRCLING	1160-1 478 (500-1)	1240-1 558 (600-1)	1360-2 678 (700-2)	1360-2¼ 678 (700-2¼)