RNAV (RNP) Z RWY 28

LAKELAND LINDER INTL (LAL)


APP CRS		
276°	Rwy Ldg	8500
	TDZE	142
	Apt Elev	142

RNP AR APCH - GPS.


For uncompensated Baro-VNAV systems, procedure NA below -15°C or above 54°C.

MISSED APPROACH: Climb to 600 then climbing right turn to 2000 direct PLUMY and hold.

ATIS	TAMPA APP CON	LAKELAND TOWER	GND CON
118.025	120.65 290.3	124.5 236.775	121.4

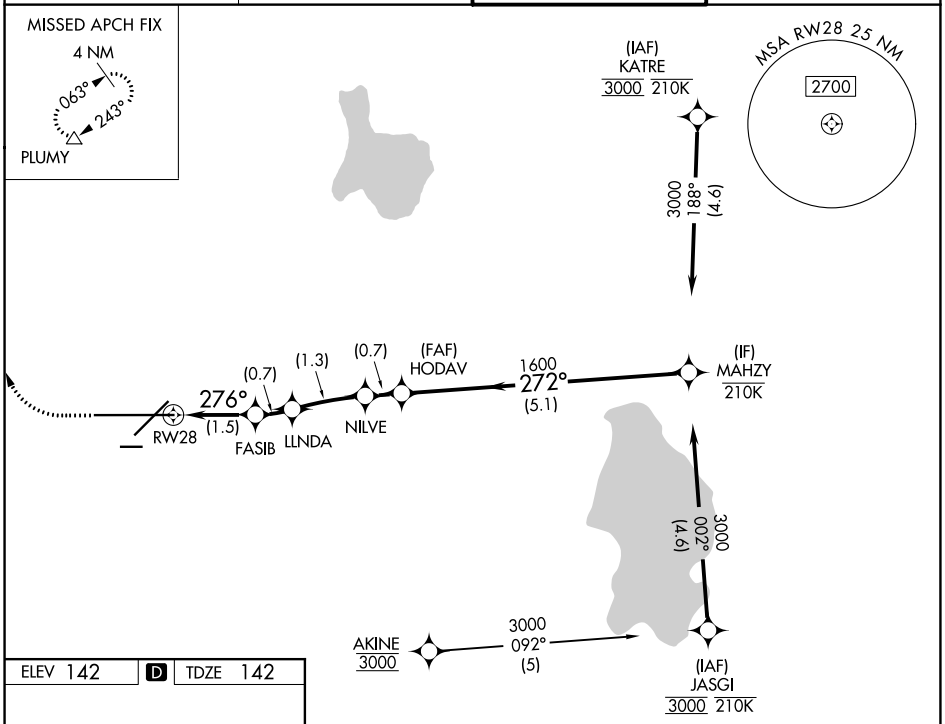


ELEV 142 D TDZE 142

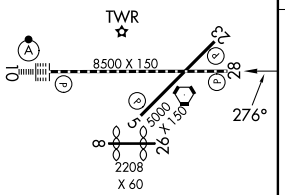

TDZL/RCLS Rwy 10
HIRL Rwys 5-23 and 10-28

600 2000 PLUMY

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 71).

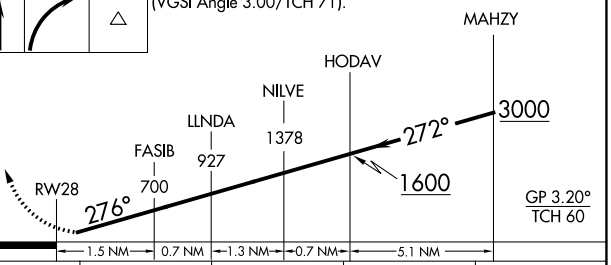

CATEGORY	A	B	C	D
RNP 0.30 DA	507/55	365 (400-1)		

AUTHORIZATION REQUIRED

SE-3, 29 OCT 2026 to 26 NOV 2026
SE-3, 29 OCT 2026 to 26 NOV 2026