YIGO, GUAM I, GUAM

# TACAN Z RWY 24R

| TACAN UAM Chan **54** | APCH CRS **231°** | Rwy ldg **10,527**<br>TDZE **617**<br>Arpt Elev **617** |
|---|---|---|

(USAF) ANDERSEN AFB (PGUA)

RADAR or DME required

* When ALS inop, increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.


ALSF-1

MISSED APPROACH: Climb to 1100, then climbing left turn to 3000 to intercept UAM R-051 to FOVEM and hold.

| ATIS | GUAM APP CON/DEP CON | TOWER | GND CON |
|---|---|---|---|
| **118.175 254.325** | **119.8 269.0** | **126.2 233.7** | **121.7 275.8** |


CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

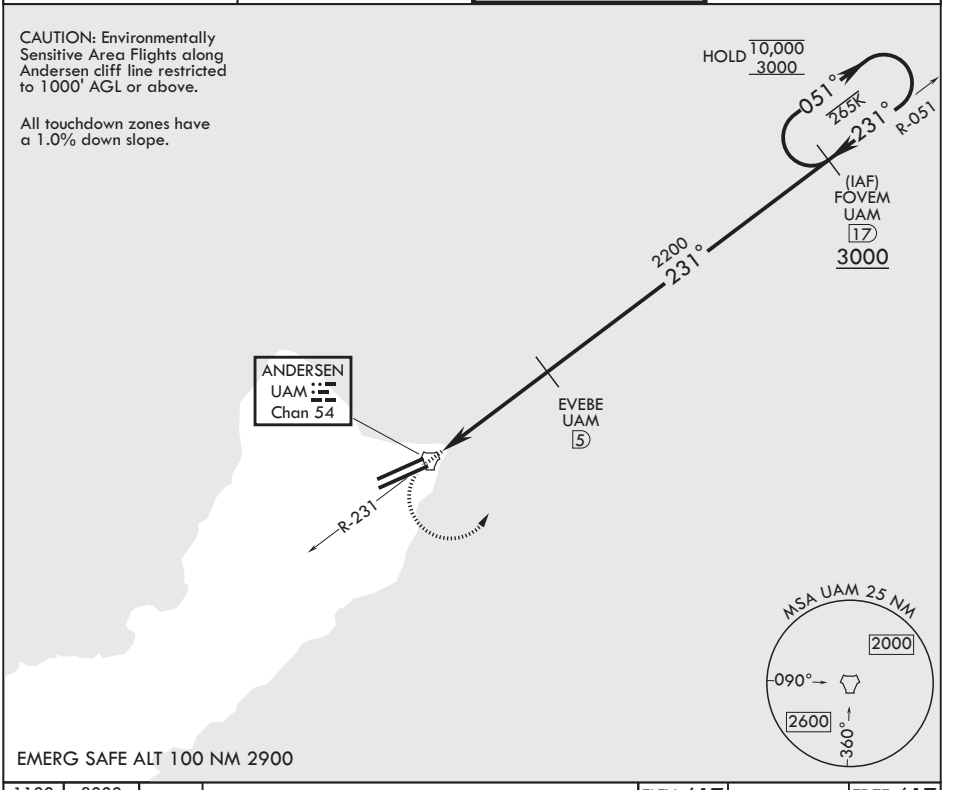



1100 | 3000 UAM R-051 | FOVEM UAM 17

VGSI and ILS glidepath not coincident (VGSI angle 3.00/TCH 59).

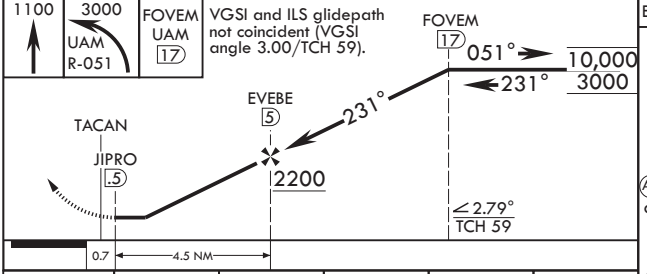


ELEV 617 TDZE 617

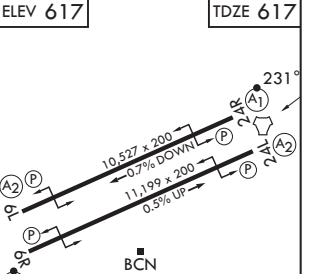


| CATEGORY | A | B | C | D | E |
|---|---|---|---|---|---|
| S-24R* | 940/24 323 (400-½) | | 940/40 | 323 | (400-¾) |
| CIRCLING** | 1060-1<br>443 (500-1) | 1080-1<br>463 (500-1) | 1240-1¾<br>623<br>(700-1¾) | 1240-2<br>623 (700-2) | 1240-2¼<br>623<br>(700-2¼) |

HIRL all rwys