ILS or LOC RWY 5

CHARLOTTE/MONROE EXEC (EQY)

LOC/DME I-EQY	APP CRS	Rwy Ldg	7001
109.75	053°	TDZE	683
Chan 34(Y)		Apt Elev	683


DME required. RADAR required for procedure entry.


Rwy 5 helicopter visibility reduction below ¾ SM NA. Inop table does not apply to S-ILS 5 all Cats. For inop ALS, increase S-LOC 5 all Cats visibility to 1 SM.


MALSR

MISSED APPROACH: Climb to 1180 then climbing right turn to 3000 on heading 196° and CTF VOR/DME R-317 to HUSTN/CTF 20.5 DME and hold, continue climb-in-hold to 3000.

ASOS	CHARLOTTE APP CON	CLNC DEL	UNICOM
135.775	120.05 307.8	132.55	122.7 (CTAF)

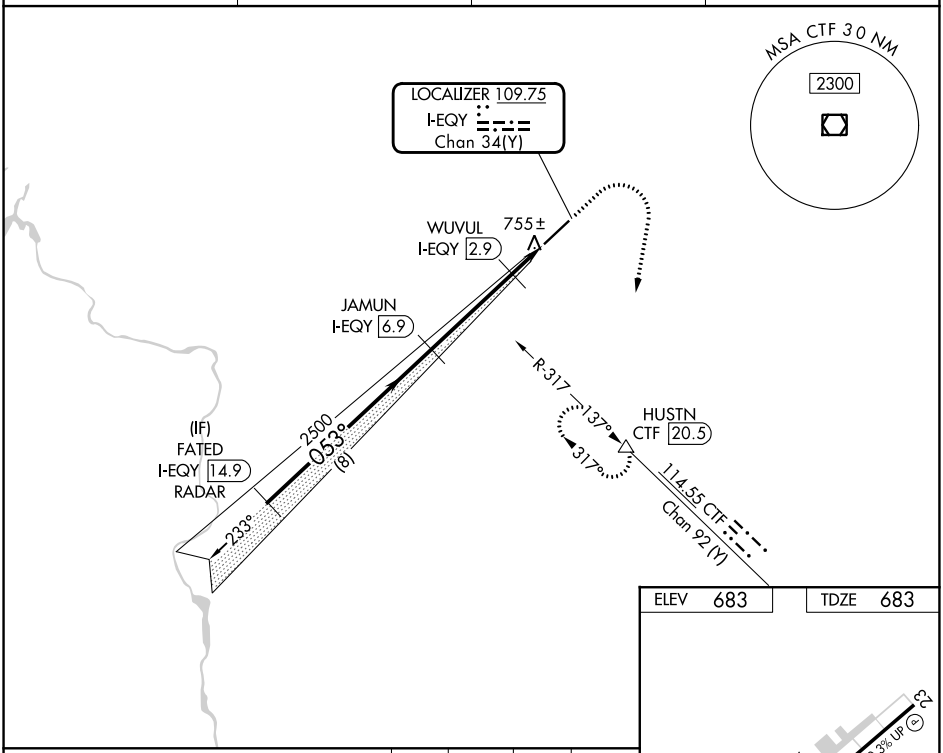

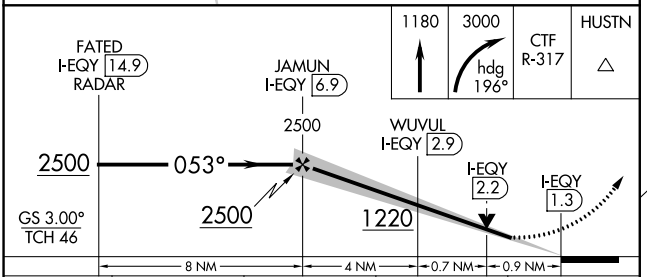

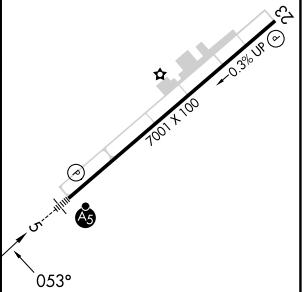

CATEGORY	A	B	C	D
S-ILS 5	933-¾	250 (300-¾)		
S-LOC 5	1020-¾	337 (400-¾)		
CIRCLING	1220-1	537 (600-1)	1220-1½ 537 (600-1½)	1480-2½ 797 (800-2½)

HIRL Rwy 5-23
REIL Rwy 23

FAF to MAP 5.6 NM

Knots	60	90	120	150	180
Min:Sec	5:35	3:44	2:48	2:14	1:52

SE-2, 29 OCT 2026 to 26 NOV 2026
SE-2, 29 OCT 2026 to 26 NOV 2026