WAAS CH 90505 W04A	APP CRS 037°	Rwy Ldg 5500 / TDZE 904 / Apt Elev 904

RNAV (GPS) RWY 4

BOLTON FLD (TZR)


RNP APCH.

For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -16°C or above 54°C. For inop ALS, increase LNAV/VNAV all Cats visibility to 1¼ SM and LNAV Cats C/D visibility to 1⅜ SM.

MALSR

MISSED APPROACH: Climb to 3000 direct OYILU and left turn on track 294° to MECAN and hold.


AWOS-3PT	COLUMBUS APP CON	BOLTON TOWER★	GND CON
135.925	134.0 279.6	128.1 (CTAF) L	121.8

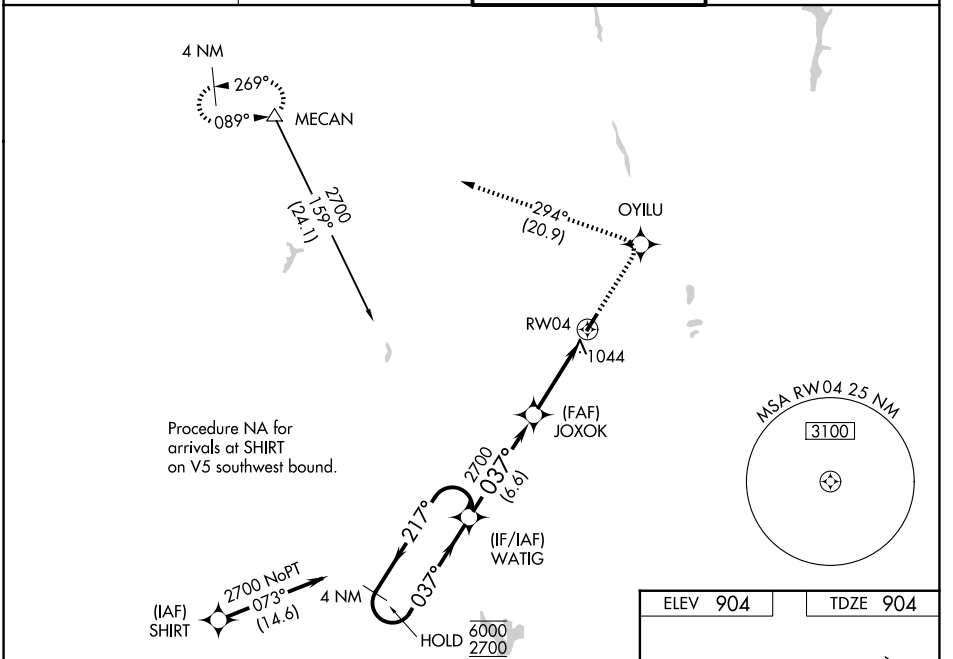


VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 25).

3000	OYILU	tr 294°	MECAN

4 NM Holding Pattern

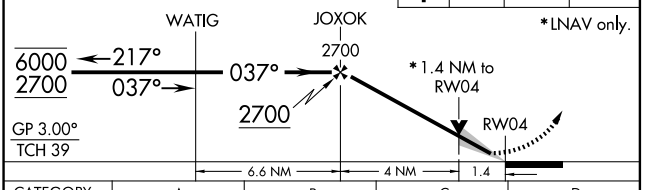

*LNAV only.

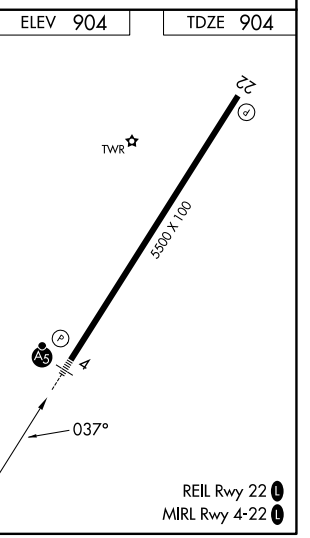

CATEGORY	A	B	C	D
LPV DA	1163-½ 259 (300-½)			
LNAV/VNAV DA	1325-1 421 (500-1)			
LNAV MDA	1360-½ 456 (500-½)		1360-⅞ 456 (500-⅞)	1360-1 456 (500-1)
CIRCLING	1360-1 456 (500-1)	1380-1 476 (500-1)	1380-1½ 476 (500-1½)	1500-2 596 (600-2)

EC-2, 29 OCT 2026 to 26 NOV 2026
EC-2, 29 OCT 2026 to 26 NOV 2026