VORTAC MSN	APP CRS	Rwy Ldg	4001
108.6	254°	TDZE	928
Chan 23		Apt Elev	928

VOR RWY 28


MIDDLETON MUNI/MOREY FLD (C29)


T When local altimeter setting not received, use Dane County Rgnl/Truax Fld altimeter setting and increase all MDAs 40 feet and S-28 visibility Cat C ⅛ SM, and Circling visibility Cat C ¼ SM. RADAR or DME required. Circling NA to Rwys 1 and 19. Rwy 28 helicopter visibility reduction below 1 SM NA. Straight-in Rwy 28 NA at night, Circling Rwy 28 NA at night.

A

MISSED APPROACH: Climb to 2000 then climbing right turn to 3500 on heading 020° and MSN R-282 to IMMES INT/9.2 DME and hold.

AWOS-3	MADISON APP CON★	UNICOM
118.675	135.45 343.7	123.0 (CTAF) L

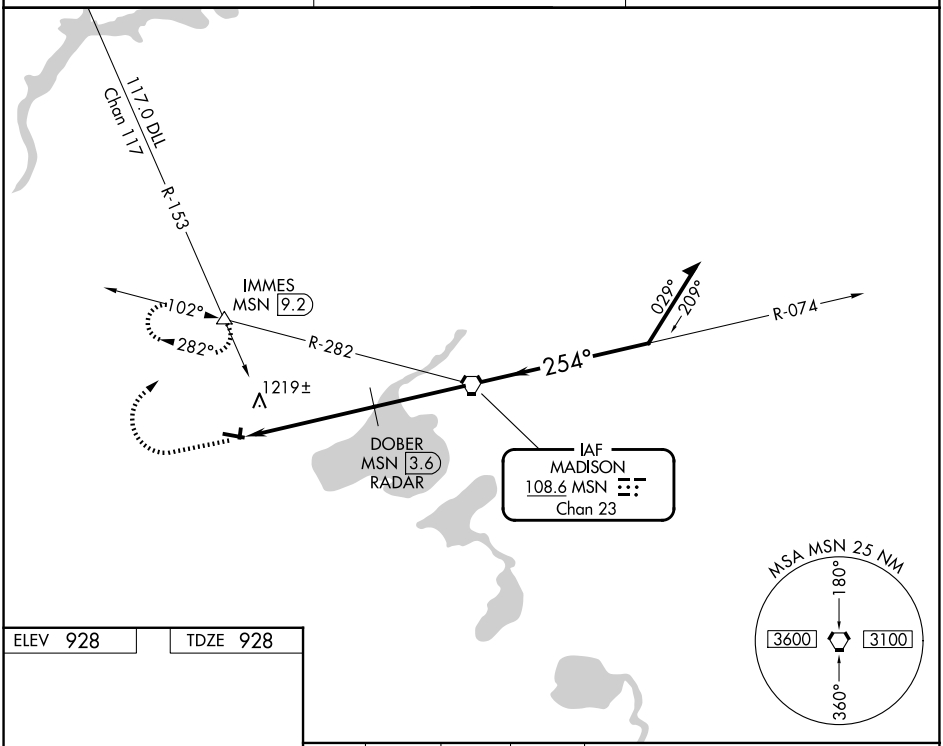

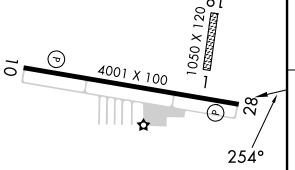


ELEV 928 TDZE 928

MIRL Rwy 10-28 L
REIL Rwys 10 and 28 L

FAF to MAP 8.4 NM

Knots	60	90	120	150	180
Min:Sec	8:24	5:36	4:12	3:22	2:48

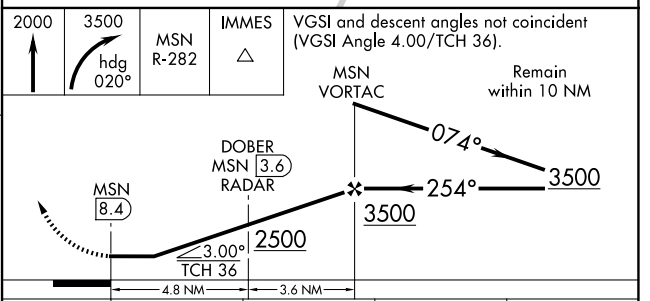

CATEGORY	A	B	C	D
S-28	1500-1	572 (600-1)	1500-1⅝ 572 (600-1⅝)	NA
CIRCLING	1560-1 632 (700-1)	1640-1 712 (800-1)	1660-2 732 (800-2)	NA

EC-3, 29 OCT 2026 to 26 NOV 2026
EC-3, 29 OCT 2026 to 26 NOV 2026