KUSSO THREE DEPARTURE (RNAV)

(KUSSO3.KUSSO) 14MAY26

WEATHERFORD, TEXAS

PARKER COUNTY (WEA)

LONE STAR DEP CON
135.975 379.9
CTAF
122.7

RNAV 1 - DME/DME/IRU or GPS required.


RADAR required.

TOP ALTITUDE: ASSIGNED BY ATC

TAKEOFF MINIMUMS
Rwys 17, 35: Standard.

1600

001°

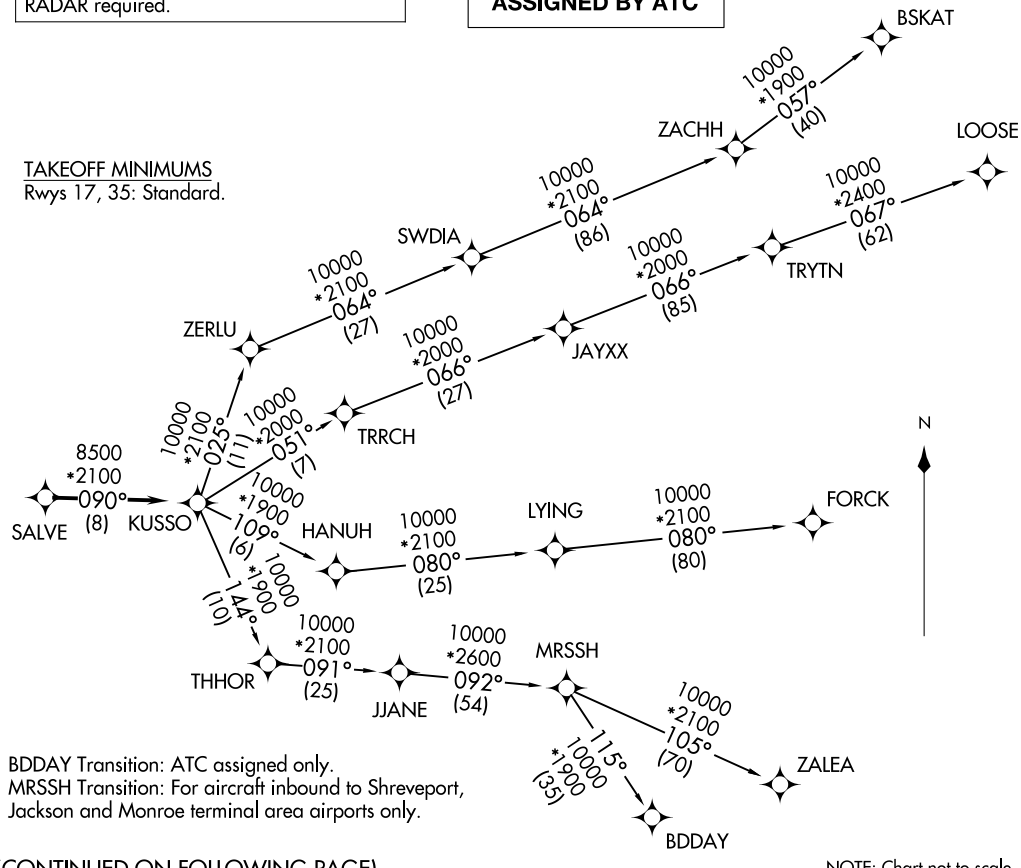

MSA WEA 25 NM
3600

NOTE: BDDAY Transition: ATC assigned only.
NOTE: MRSSH Transition: For aircraft inbound to Shreveport, Jackson and Monroe terminal area airports only.

(CONTINUED ON FOLLOWING PAGE)

NOTE: Chart not to scale.

KUSSO THREE DEPARTURE (RNAV)

(KUSSO3.KUSSO) 26134

AL-6497 (FAA)

PARKER COUNTY (WEA)
WEATHERFORD, TEXAS

DEPARTURE ROUTE DESCRIPTION

TAKEOFF RUNWAY 35: Climb on heading 001° to 1600 before turning left.

When entering controlled airspace, fly heading assigned by ATC, expect RADAR vectors to SALVE, then on track 090° to KUSSO, then on assigned transition. Maintain ATC assigned altitude, expect filed altitude 10 minutes after departure.

BDDAY TRANSITION (KUSSO3.BDDAY)
BSKAT TRANSITION (KUSSO3.BSKAT)
FORCK TRANSITION (KUSSO3.FORCK)
LOOSE TRANSITION (KUSSO3.LOOSE)
MRSSH TRANSITION (KUSSO3.MRSSH)
ZALEA TRANSITION (KUSSO3.ZALEA)

SC-2, 29 OCT 2026 to 26 NOV 2026