KUSSO THREE DEPARTURE (RNAV)


(KUSSO3.KUSSO) 14MAY26


LONE STAR DEP CON
135.975 379.9
CTAF
123.0


RNAV 1 - DME/DME/IRU or GPS required.
RADAR required.

TOP ALTITUDE: ASSIGNED BY ATC

TAKEOFF MINIMUMS
Rwy 35: Standard.
Rwy 17: 300-2 or standard with minimum climb of 512' per NM to 1300.

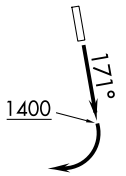

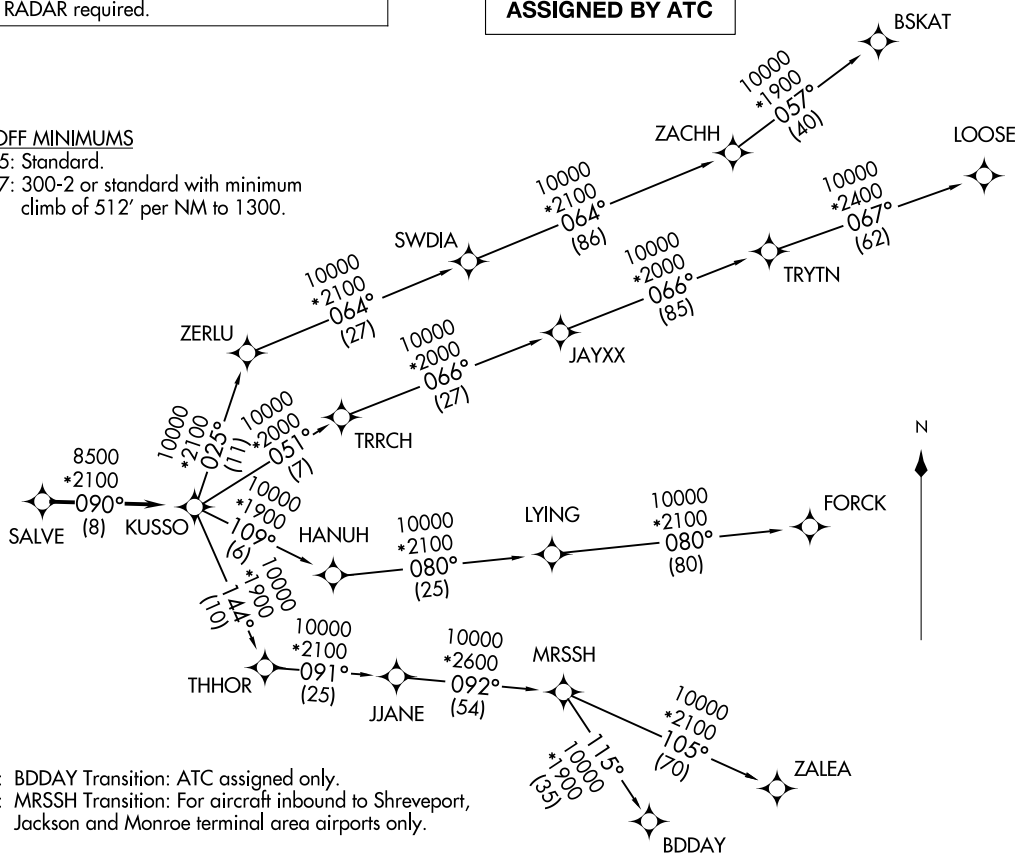

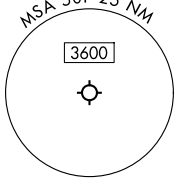

NOTE: BDDAY Transition: ATC assigned only.
NOTE: MRSSH Transition: For aircraft inbound to Shreveport, Jackson and Monroe terminal area airports only.

(CONTINUED ON FOLLOWING PAGE)

NOTE: Chart not to scale.

FORT WORTH, TEXAS
BOURLAND FLD (5F)

(KUSSO3.KUSSO) 26134
KUSSO THREE DEPARTURE (RNAV)

AL-6854 (FAA)

FORT WORTH, TEXAS
BOURLAND FLD (5F)

DEPARTURE ROUTE DESCRIPTION

TAKEOFF RUNWAY 17: Climb on heading 171° to 1400 before turning right.

When entering controlled airspace, fly heading assigned by ATC, expect RADAR vectors to SALVE, then on track 090° to KUSSO, then on assigned transition. Maintain ATC assigned altitude, expect filed altitude 10 minutes after departure.

BDDAY TRANSITION (KUSSO3.BDDAY)
BSKAT TRANSITION (KUSSO3.BSKAT)
FORCK TRANSITION (KUSSO3.FORCK)
LOOSE TRANSITION (KUSSO3.LOOSE)
MRSSH TRANSITION (KUSSO3.MRSSH)
ZALEA TRANSITION (KUSSO3.ZALEA)

SC-2, 29 OCT 2026 to 26 NOV 2026