REPUBLIC

FERRY CO (R49) 6 NE UTC–8(–7DT) N48º43.09´ W118º39.39´ **SEATTLE**
L–13A

2522 B TPA—3322(800) NOTAM FILE SEA

RWY 17–35: H3498X60 (ASPH) MIRL

RWY 17: Trees. Rgt tfc.

RWY 35: PAPI(P2L)—GA 4.0º TCH 40´. Trees.

SERVICE: **LGT** ACTVT PAPI Rwy 35; MIRL Rwy 17–35—122.8.

AIRPORT REMARKS: Unattended. Suggest ngt ldgs be made on Rwy 35. Rwy 17–35 trees located on unlgtd unmarked mountainous terrain. P–lines NE of Rwy 17 lgtd dusk–dawn. Wildlife invof of rwy.

AIRPORT MANAGER: 616 822-0483

COMMUNICATIONS: CTAF 122.9

CLEARANCE DELIVERY PHONE: For CD ctc Seattle ARTCC at 253-351-3694.

RADIO AIDS TO NAVIGATION: NOTAM FILE EPH.

EPHRATA (VH) (H) VORTACW 112.6 EPH Chan 73 N47º22.68´ W119º25.44´ 360º 86.2 NM to fld. 1250/21E.

VOR unusable:
010º–014º byd 40 NM
042º–054º byd 40 NM
214º–228º byd 40 NM blo 7,000´
214º–228º byd 52 NM blo 10,000´
214º–228º byd 77 NM
229º–247º byd 40 NM
310º–350º byd 25 NM blo 6,500´
310º–353º byd 40 NM
358º–004º byd 40 NM

TACAN AZIMUTH unusable:
280º–295º byd 25 NM blo 7,000´
310º–350º byd 25 NM blo 6,500´

DME unusable:
280º–295º byd 25 NM blo 7,000´
310º–350º byd 25 NM blo 6,500´

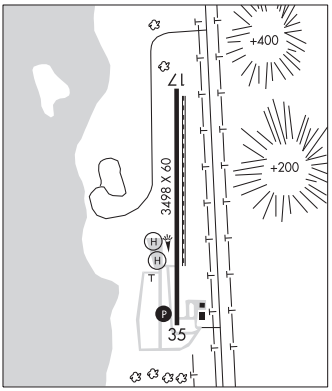

HELIPAD H1: H20X20 (CONC)

HELIPAD H2: H20X20 (CONC)