

THOMPSON PASS (K55) 17 E UTC–9(–8DT) N61°10.64′ W145°41.31′ **ANCHORAGE**
2080 NOTAM FILE JNU
RWY 05–23: 2530X9 (TURF–GRVL)
RWY 05: Brush.
RWY 23: Brush.
AIRPORT REMARKS: Unattended. All ops PPR—amgr. Rwy 05–23 unsafe for landg, tkof or TGL due to debris on rwy – amgr. Rwy cond unmnt: rcmd visual insp prior to use. High trrn all quads. Exp turbulent wind. Unctld vehicle tfc on rwy. Rwy end 23: Pwr line crosses hill on apch end. Rwy end 05: first 300 ft soft & rutted. 1 ft grass & brush first 1200 ft; remainder 10 ft brush. Rwy 05–23: E side 9 ft unusbl; rmng overgrown with 4 ft brush. Rwy 05–23: east half of rwy overgrown 10 ft brush; strip 10 x 2270 ft unusable. West half of rwy loose gravel and small brush to 6 in. Rwy 05–23 soft aft rain, rises slightly at each end.
AIRPORT MANAGER: 907-269-8400
COMMUNICATIONS: CTAF 122.9
RCO 122.55 (JUNEAU RADIO)
RADIO AIDS TO NAVIGATION: NOTAM FILE VDZ.
MINERAL CREEK NDB (MHW) 524 MNL N61°07.45′ W146°21.13′ 061° 19.6 NM to fld. 21/19E.
NDB unusable:
320°–010° byd 15 NM
COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1–866–297–2236.

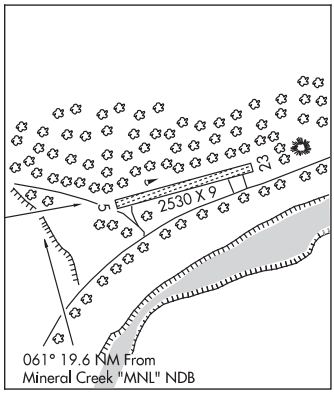

VALDEZ PIONEER FLD (VDZ)(PAVD) 3 E UTC–9(–8DT) N61°08.05′ W146°14.69′ **ANCHORAGE**
128 B LRA ARFF Index—See Remarks NOTAM FILE VDZ **H–1B, L–1A, 3E, 4H**
IAP
RWY 06–24: H6500X150 (ASPH–GRVD) S–107, D–187, 2D–346 PCR 407 F/A/X/T HIRL 1.1% up E
RWY 06: MALSR. PAPI(P4L)—GA 3.0° TCH 29′. Trees. Rgt tfc.
RWY 24: REIL. Trees.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 06: TORA–6500 TODA–6500 ASDA–6500 LDA–6500
RWY 24: TORA–6500 TODA–6500 ASDA–6500 LDA–6500
SERVICE: S2 **FUEL** 100LL, JET A **LGT** ACTVT MALSR Rwy 06; REIL Rwy 24; PAPI Rwy 06; HIRL Rwy 06–24—CTAF.
AIRPORT REMARKS: Attended Mon–Fri 1500–0330Z‡, Sat–Sun 1700–0330Z‡. Fuel A: PPR – 907–834–6933. Maint hrs Mon–Fri 1500–0330Z‡; Sat–Sun 1700–0330Z‡. Alert: durg strong N wind; midfld and E end rwy wind may be much hyr than AWOS indcd. Class I, ARFF Index: clsd to ACR ops more than 30 pax seats exc 24 hr PPR in writing–AMGR PO Box 507 Valdez, AK 99686; FAX 907–835–5849. Arpt sand lrgr than FAA rcmdd/see AC 150/5200–30. 1675 x 200 ft SW ptn of ramp not mntnd Nov 1 to Apr 15. Cold temperature airport. Altitude correction required at or below –10C. Alert: See Special Notices—Port Valdez Area.
AIRPORT MANAGER: 907-835-5658
WEATHER DATA SOURCES: AWOS–3P 118.8 (907) 560–7614. (WX CAM)
COMMUNICATIONS: CTAF 122.9
RCO 122.2 (JUNEAU RADIO)
ANCHORAGE CENTER APP/DEP CON 119.3 269.4
RADIO AIDS TO NAVIGATION: NOTAM FILE VDZ.
MINERAL CREEK NDB (MHW) 524 MNL N61°07.45′ W146°21.13′ 060° 3.2 NM to fld. 21/19E.
NDB unusable:
320°–010° byd 15 NM
LDA/DME 109.5 I–VDZ Chan 32 Rwy 06. LOC unusable byd 10° left of course; unusable byd 25° rgt of course; byd 11.2 NM blw 4,635′. DME unusable byd 10° left of course; unusable byd 20° rgt of course; byd 11.2 NM blw 4,635′.
COMM/NAV/WEATHER REMARKS: For a toll free call to Juneau FSS dial 1–866–297–2236.

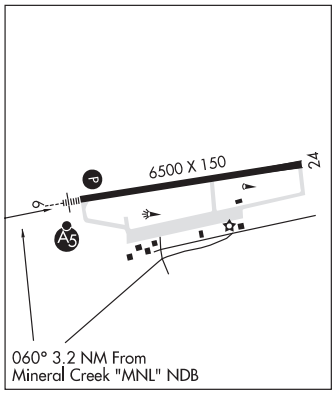

VALLEY FLYING CROWN (See WASILLA on page 278)