
JOHNSON CITY

STANTON CO MUNI (JHN)(KJHN) 2 NE UTC–6(–5DT) N37°35.12′ W101°43.94′ **WICHITA**
3325 B NOTAM FILE ICT **L–10G, 15B**
RWY 17–35: H5200X75 (CONC) S–34, D–46 PCN 11 R/C/X/U MIRL **IAP**
RWY 17: PAPI(P4L)—GA 3.0° TCH 40′.
RWY 35: PAPI(P4L)—GA 3.0° TCH 40′.
RWY 08–26: H1889X60 (ASPH) S–3 PCN 4 R/C/Y/U
SERVICE: S4 **FUEL** 100LL, JET A **OX** 1 **LGT** MIRL Rwy 17–35 preset on low intst dusk–0400Z‡; to incr intst and ACTVT aft 0400Z‡—CTAF.
AIRPORT REMARKS: Attended 1400–0000Z‡. Rwy 08–26 surface cracking. Pub telephone avbl 24 hrs 620–492–2414.
AIRPORT MANAGER: 580-330-0589
WEATHER DATA SOURCES: AWOS–3PT 124.175 (620) 492–2100.
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **KANSAS CITY CENTER APP/DEP CON** 125.2
CLEARANCE DELIVERY PHONE: For CD ctc Kansas City ARTCC at 913-254-8508.
RADIO AIDS TO NAVIGATION: NOTAM FILE LBL.
LIBERAL (H) TACAN Chan 70 LBL (112.3) N37°02.66′ W100°58.27′ 301° 48.8 NM to fld. 2881/11E.
TACAN AZIMUTH unusable:
240°–280°

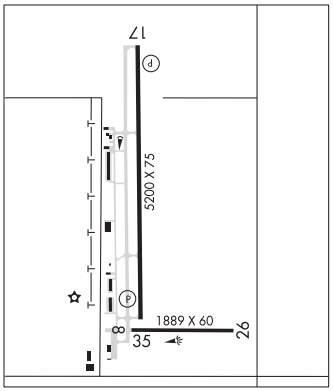

JOHNSON CO EXEC (See OLATHE on page 125)

JUNCTION CITY

FREEMAN FLD (3JC) 1 NW UTC–6(–5DT) N39°02.60′ W96°50.60′ **KANSAS CITY**
1102 B NOTAM FILE ICT **L–10I**
RWY 18–36: H3498X75 (ASPH) S–10 PCN 5 F/C/Y/U MIRL **IAP**
0.4% up S
RWY 18: PAPI(P2L)—GA 3.0° TCH 43′. Tree.
RWY 36: PAPI(P2L)—GA 3.5° TCH 43′. Trees.
RWY 13–31: 1903X140 (TURF)
RWY 13: Trees.
RWY 31: Trees.
RWY 05–23: 1834X200 (TURF) 0.5% up S
RWY 05: Tree.
RWY 23: Pole.
SERVICE: S4 **FUEL** 100LL, JET A **LGT** ACTVT PAPI Rwy 36; MIRL Rwy 18/36—CTAF.
AIRPORT REMARKS: Attended 1400–2300Z‡. Waterfowl on and invof arpt. Nstd air traffic control minima applied IFR arrivals with respect to high performance acft ops conducted within confines of R–3602. Rwy 13 thld, 4 ft grade change between Rwy 13 and Rwy 18–36. Not suitable for acft. Mkd with tires. Rwy 05–23 and Rwy 13–31 thlds mkd with svrl 12 in dia raised steel plates as rwy nmbrs on cntrln – unsuitable to taxi over. Rwy 05–23 and Rwy 13–31 thld mkd with blue and white plastic barrels. Rwy, twy and apron cond fair, turf soft when wet. Baseball field lgt poles 918 ft to 1303 ft from rwy end, 338 ft to 672 ft right, 1175 AMSL. Cold temperature airport. Altitude correction required at or below –22C.
AIRPORT MANAGER: 785-210-9065
COMMUNICATIONS: CTAF/UNICOM 122.8
Ⓡ **MARSHALL AAF GCA APP/DEP CON** 121.25 (Mon–Thu 1400–0700Z‡; Fri 1400–2200Z‡, exc hol other times ctc)
Ⓡ **KANSAS CITY CENTER APP/DEP CON** 127.35 (Mon–Fri 0700–1400Z‡; Fri 2200–1400Z‡, exc hol)
CLEARANCE DELIVERY PHONE: For CD ctc Marshall Apch at 785-239-2118. When Marshall Apch is clsd, ctc Kansas City ARTCC at 913-254-8508.
RADIO AIDS TO NAVIGATION: NOTAM FILE SLN.
SALINA (VH) (H) VORTACW 117.1 SLN Chan 118 N38°55.51′ W97°37.28′ 072° 37.1 NM to fld. 1316/7E.
VOR unusable:
017°–026° byd 40 NM
315°–016° byd 15 NM blo 6,000′
DME unusable:
300°–042° byd 15 NM blo 6,000′
COMM/NAV/WEATHER REMARKS: FBO phone: 785–761–7692.

