
QUINCY MUNI (2J9) 2 NE UTC–5(–4DT) N30°35.87′ W84°33.45′ **JACKSONVILLE**
221 B NOTAM FILE GNV **L–21D, 22I**
RWY 14–32: H2974X75 (ASPH) S–20 PCN 9 F/A/Y/T MIRL **IAP**
0.7% up NW
RWY 14: PAPI(P2R)—GA 3.0° TCH 20′. Thld dsplcd 267′. Trees. Rgt tfc.
RWY 32: PAPI(P2L)—GA 3.0° TCH 21′. Thld dsplcd 322′. Trees.
RUNWAY DECLARED DISTANCE INFORMATION
RWY 14: TORA–2964 TODA–2964 ASDA–2964 LDA–2700
RWY 32: TORA–2964 TODA–2964 ASDA–2755 LDA–2431
SERVICE: S4 **FUEL** 100LL **LGT** ACTVT PAPI Rwy 14 & 32; MIRL Rwy 14–32—CTAF.
AIRPORT REMARKS: Attended 1300Z‡–dusk. Parachute Jumping. Deer invof movement areas. PAJA ops; glider ops blw 10,000 ft on and invof arpt.
AIRPORT MANAGER: 850-363-2083
WEATHER DATA SOURCES: AWOS–3PT 118.975 (850) 627–6264.
COMMUNICATIONS: CTAF/UNICOM 122.7
Ⓡ **TALLAHASSEE APP/DEP CON** 128.7 (1100–0400Z‡)
JACKSONVILLE CENTER APP/DEP CON 128.625 (0400–1100Z‡)
CLEARANCE DELIVERY PHONE: For CD ctc Tallahassee Apch at 850-942-8311, when Apch clsd ctc Jacksonville ARTCC at 904-845-1592.

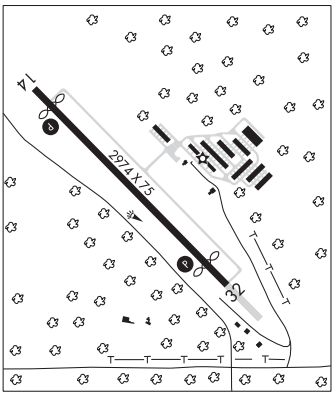

RADIO AIDS TO NAVIGATION: NOTAM FILE TLH.
SEMINOLE (VH) (H) VORTACW 117.5 SZW Chan 122 N30°33.37′ W84°22.44′ 283° 9.8 NM to fld. 178/2E.
VOR unusable:
006°–034° byd 40 NM
050°–052° byd 40 NM
060°–062° byd 40 NM
065°–068° byd 40 NM
071°–075° byd 40 NM
096°–099° byd 40 NM
103°–107° byd 40 NM
156°–161° byd 40 NM
175°–177° byd 40 NM
180°–190° byd 40 NM blo 18,000′
212°–216° byd 40 NM
220°–223° byd 40 NM
241°–243° byd 40 NM
253°–255° byd 40 NM
261°–270° byd 40 NM
274°–301° byd 40 NM
278°–288° byd 7 NM blo 1,900′
302°–312° byd 40 NM blo 2,000′
302°–312° byd 58 NM
318°–352° byd 40 NM

REYNOLDS N29°58.02′ W81°39.46′ NOTAM FILE GNV. **MIAMI**
NDB (MHW) 338 RYD 162° 162.6 NM to Treasure Coast Intl. 16/7W. **H–8I, L–24F**

RIVER RANCH RESORT (2RR) 0 NW UTC–5(–4DT) N27°46.76′ W81°12.24′ **MIAMI**
55 B NOTAM FILE PIE **L–21D, 24F**
RWY 16–34: H4950X75 (ASPH) LIRL
RWY 16: Thld dsplcd 200′. Trees.
RWY 34: Thld dsplcd 1000′. Trees. Rgt tfc.
AIRPORT REMARKS: Attended continuously. Rwy 34 250′ tower E 3000′ SE of rwy end E 2400′ rt of cl. 30′ brush and trees 125′ from centerline both sides of rwy. Unlgtd obstns, trees 120 ft left of cntrln & 315 ft bfr AER Rwy 16. Rwy 16–34 thld markings have incorrect spacing. Rwy 16–34 has wdspr cracking and producing loose aggregate. Rwy 16–34 markings faded. RSA has standing water after heavy rain events.
AIRPORT MANAGER: 863-692-1321
COMMUNICATIONS: CTAF/UNICOM 122.8
CLEARANCE DELIVERY PHONE: For CD ctc Miami ARTCC at 305-716-1731.
RADIO AIDS TO NAVIGATION: NOTAM FILE VRB.
TREASURE (DL) DME 117.3 TRV Chan 120 N27°40.71′ W80°29.38′ 279° 38.5 NM to fld. 22.
TACAN AZIMUTH OTS indef

ROSCOE FLD (See PENSACOLA on page 162)