

**NEWTOK SPB** (WWT) 0 S UTC-9(-8DT) N60°55.42' W164°39.37'

BETHEL

6 NOTAM FILE ENA

WATERWAY E-W: 5000X400 (WATER)

**SEAPLANE REMARKS:** Unattended. Landing area and dock in river. Lake avbl behind village for fall and winter. Be alert: Multiple boats along landing area. Be alert: water in ldg area very shallow. Be alert of waterbirds in and around the ldg area.**COMMUNICATIONS:** CTAF 122.9**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737.**NEWTON PEAK** N64°33.39' W165°19.16'

NOME

RCO 122.5 (NOME RADIO)

L-3A, 3B, 4H

**NICHOLS** N55°04.25' W131°36.30' NOTAM FILE ANN.

KETCHIKAN

NDB (HW) 266 ICK 128° 2.1 NM to Annette Island. 119/18E.

H-1D, L-1C

**NIGHTMUTE** (IGT)(PAGT) 1 N UTC-9(-8DT) N60°28.15' W164°42.24'

BETHEL

7 B NOTAM FILE ENA

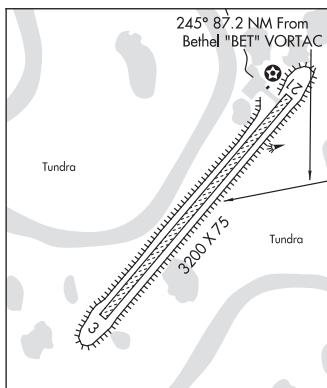
RWY 03-21: 3200X75 (GRVL-DIRT) MIRL

RWY 21: Brush.

**SERVICE:** LGT Actvt MIRL Rwy 03-21, and rotating beacon—CTAF.**AIRPORT REMARKS:** Unattended. Bird activity invof arpt. Rwy condition not monitored, recommend visual inspection prior to using. Windssock unreliable. Rwy 03-21 NSTD markings, rwy marked with reflective cones and flexible markers. Rwy 03-21 dips in rwy sfc; irregular sfc's full length. Rwy surface is soft gravel, caution surface can be very soft when wet. Loose gravel along rwy edge can be very soft.**AIRPORT MANAGER:** (907) 543-2498**COMMUNICATIONS:** CTAF 122.9**RADIO AIDS TO NAVIGATION:** NOTAM FILE BET.

BETHEL (H) (H) VORTACW 114.1 BET Chan 88 N60°47.09'

W161°49.46' 245° 87.2 NM to fld. 105/14E.

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737.**NIKISHKA** N60°43.18' W151°21.99'

ANCHORAGE

RCO 122.0 (KENAI RADIO)

L-1A, 3D, 4F

**NIKLASON LAKE SPB** (See WASILLA on page 256)**NIKOLAI** (FSP)(PAFS) 1 NE UTC-9(-8DT) N63°01.11' W154°21.51'

MC GRATH

447 B NOTAM FILE FSP

H-1B, 2K, L-3D

RWY 05-23: 4001X75 (GRVL) MIRL

IAP

RWY 05: REIL. PAPI(P4L)—GA 3.2° TCH 26'. Brush.

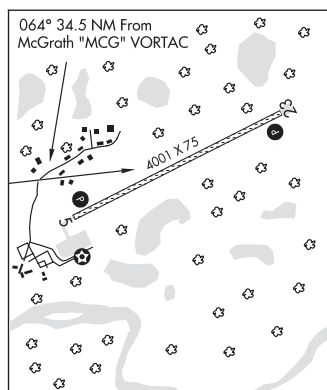
RWY 23: REIL. PAPI(P4L)—GA 3.2° TCH 28'. Brush.

**SERVICE:** LGT ACTVT REIL Rwy 05, Rwy 23; PAPI Rwy 05, Rwy 23;

MIRL Rwy 05-23—CTAF. ACTIVATE rotg bcn—CTAF.

**AIRPORT REMARKS:** Unattended. Rwy condition not monitored; recommend visual inspection prior to landing. Rwy 05-23 multiple rwy lgts broken length of rwy. Brush and grass obscuring some lgts. Brush growing inside of segmented circle.**AIRPORT MANAGER:** 907-524-3241**WEATHER DATA SOURCES:** AWOS-3P 118.325 (907) 293-2002. (WX CAM)**COMMUNICATIONS:** CTAF 122.8

Ⓡ ANCHORAGE CENTER APP/DEP CON 128.1

**COMM/NAV/WEATHER REMARKS:** For a toll free call to Kenai FSS dial 1-866-864-1737.**NIKOLAI CREEK** (See TYONEK on page 247)