


LOC/DME I-AQI 111.75	APP CRS 101°	Rwy Idg 10113 TDZE 809 Apt Elev 815
Chan 54 (Y)		

ILS or LOC RWY 10R

JOHN GLENN COLUMBUS INTL (CMH)



ADF required. DME or RADAR required.		MALSR	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BU LOM and hold.		
Simultaneous approach authorized.					
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC

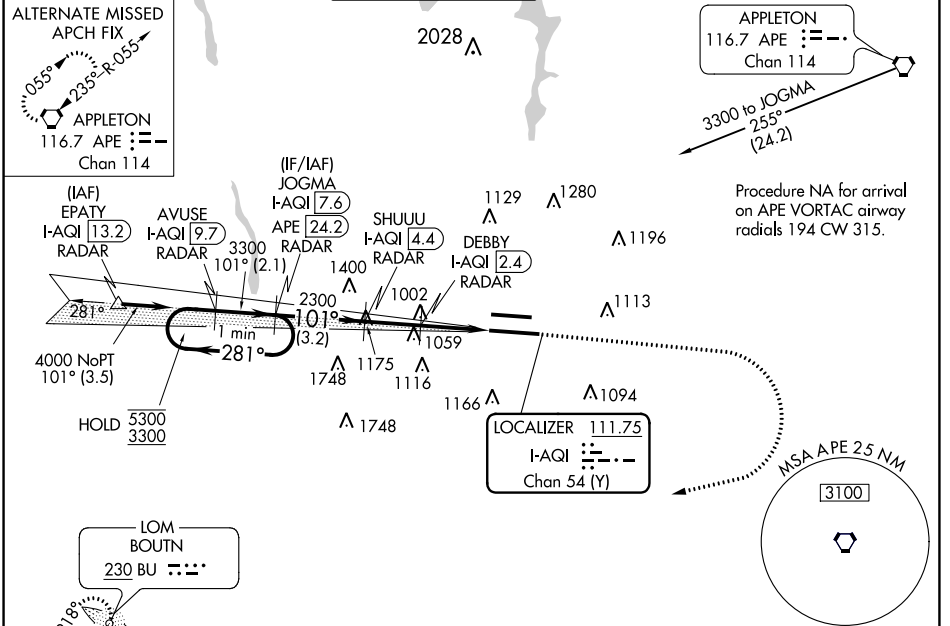

EC-2, 30 DEC 2021 to 27 JAN 2022

EC-2, 30 DEC 2021 to 27 JAN 2022

ELEV 815	D TDZE 809
----------	-------------------

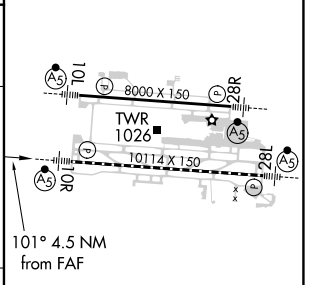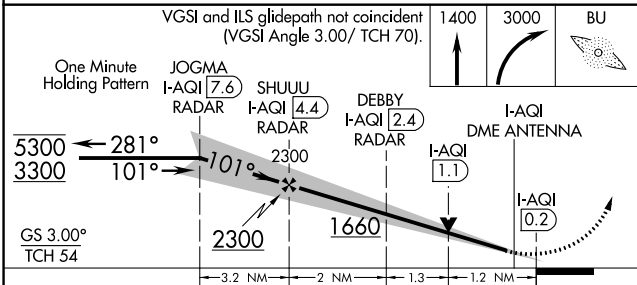

CATEGORY	A	B	C	D																															
S-ILS 10R	1009/18		200 (200-½)																																
S-LOC 10R	1260/24	451 (500-½)	1260/45	451 (500-¾)																															
C CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 ¼ 705 (800-2 ¼)																															
<table border="1"> <tr> <td>TDZ/CL Rwy 10R-28L</td> <td colspan="5"></td> </tr> <tr> <td>HIRL Rwy 10R-28L and 10L-28R</td> <td colspan="5"></td> </tr> <tr> <td colspan="6">FAF to MAP 4.5 NM</td> </tr> <tr> <td>Knots</td> <td>60</td> <td>90</td> <td>120</td> <td>150</td> <td>180</td> </tr> <tr> <td>Min:Sec</td> <td>4:30</td> <td>3:00</td> <td>2:15</td> <td>1:48</td> <td>1:30</td> </tr> </table>						TDZ/CL Rwy 10R-28L						HIRL Rwy 10R-28L and 10L-28R						FAF to MAP 4.5 NM						Knots	60	90	120	150	180	Min:Sec	4:30	3:00	2:15	1:48	1:30
TDZ/CL Rwy 10R-28L																																			
HIRL Rwy 10R-28L and 10L-28R																																			
FAF to MAP 4.5 NM																																			
Knots	60	90	120	150	180																														
Min:Sec	4:30	3:00	2:15	1:48	1:30																														