

LOC/DME I-CMH 111.75	APP CRS 281°	Rwy Idg 10113
Chan 54 (Y)		TDZE 815
		Apt Elev 815

ILS or LOC RWY 28L

JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.


∇ Simultaneous approach authorized.

▲ For inop ALS, increase S-LOC 28L Cat C/D visibility to 1 3/8 SM.



MALSR

MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

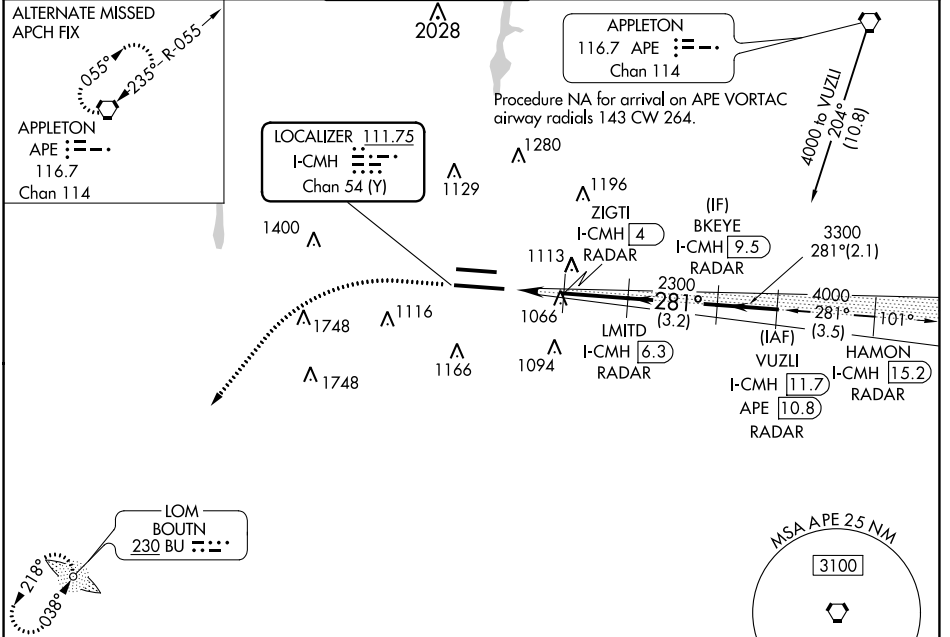

ELEV 815	D	TDZE 815
----------	----------	----------

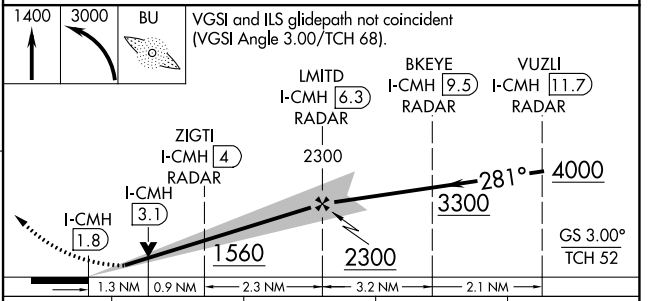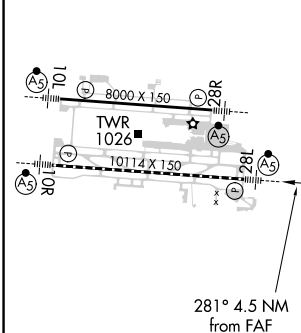

TDZ/CL Rwy 10R-28L HIRL Rwys 10R-28L and 10L-28R FAF to MAP 4.5 NM					
Knots	60	90	120	150	180
Min:Sec	4:30	3:00	2:15	1:48	1:30
C CIRCLING	1340-1 525 (600-1)		1520-2 705 (800-2)		1520-2 1/4 705 (800-2 1/4)

EC-2, 30 DEC 2021 to 27 JAN 2022

EC-2, 30 DEC 2021 to 27 JAN 2022