


APP CRS	Rwy Idg	10113
101°	TDZE	809
	Apt Elev	815

RNAV (RNP) Z RWY 10R



JOHN GLENN COLUMBUS INTL (CMH)

RNP AR APCH.		MALSR	MISSED APPROACH: Climb to 1400 then climbing right turn to 3000 direct BOUTN LOM and hold.
<p>Simultaneous approach authorized. For uncompensated Baro-VNAV systems, procedure NA below -19°C or above 54°C. For inop ALS, increase RNP 0.30 all Cats visibility to RVR 6000.</p>			

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

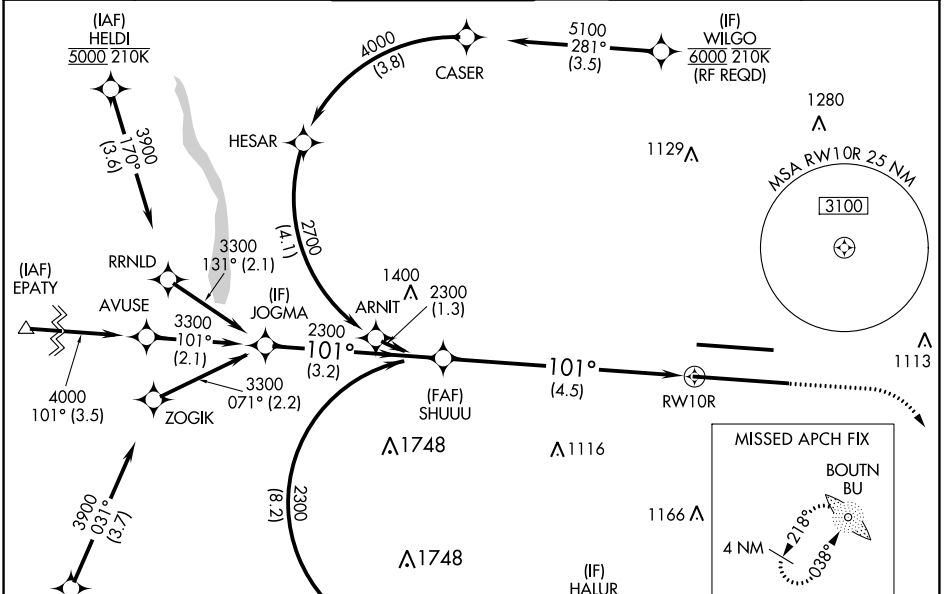

ELEV	815	TDZE	809
------	-----	------	-----

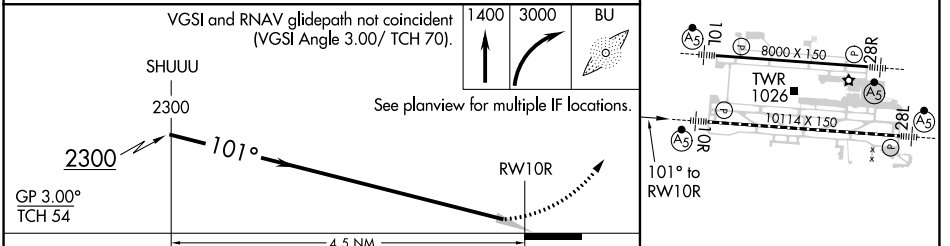

CATEGORY	A	B	C	D
RNP 0.17 DA		1138/26	329 (400-1/2)	
RNP 0.30 DA		1214/40	405 (400-3/4)	

AUTHORIZATION REQUIRED

TDZ/CL Rwy 10R-28L
HIRL Rwy 10R-28L and 10L-28R

EC-2, 30 DEC 2021 to 27 JAN 2022

EC-2, 30 DEC 2021 to 27 JAN 2022