
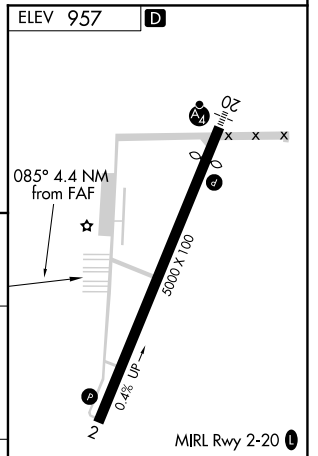
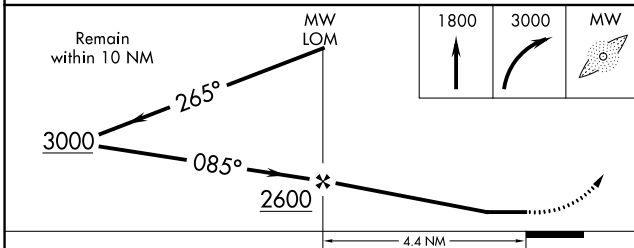
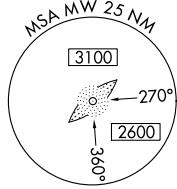


LOM MW <b>223</b>	APP CRS <b>085°</b>	Rwy Idg TDZE Apt Elev	<b>N/A</b> <b>N/A</b> <b>957</b>
----------------------	------------------------	-----------------------------	--

**NDB-A**

DAYTON-WRIGHT BROTHERS (MGY)

RADAR required for procedure entry.		MISSED APPROACH: Climb to 1800 then climbing right turn to 3000 direct MW LOM and hold.	
<p>▼ When local altimeter setting not received, use James M Cox Dayton Intl altimeter setting and increase all MDAs 60 feet, and Cat C/D visibilities ¼ SM.</p> <p>▲ NA</p>		ASOS <b>118.375</b>	COLUMBUS APP CON <b>118.85 269.275</b>
		CLNC DEL <b>119.4</b>	UNICOM <b>122.8 (CTAF)</b> <b>📻</b>

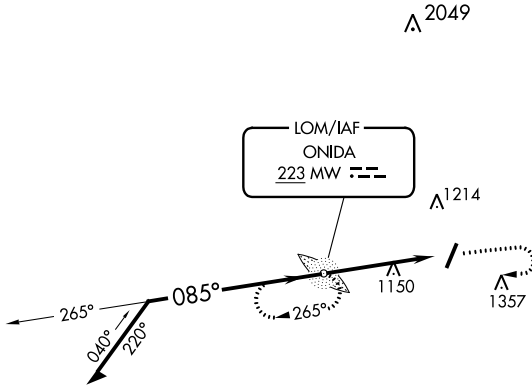

CATEGORY	A	B	C	D	FAF to MAP 4.4 NM					
CIRCLING	1480-1	1520-1	1660-2	1660-2¼	Knots	60	90	120	150	180
	523 (600-1)	563 (600-1)	703 (800-2)	703 (800-2¼)	Min:Sec	4:24	2:56	2:12	1:46	1:28