


VORTAC RSK <u>115.3</u> Chan 100	APP CRS 070°	Rwy Idg 5590 TDZE 5498 Apt Elev 5507
--	------------------------	---

VOR/DME RWY 5
FOUR CORNERS RGNL (FMN)


- T** Circling NA for Cat D southeast of Rwy 5 and south of Rwy 25. VDP NA when using Durango
A altimeter setting. When local altimeter not received, use Durango altimeter setting and increase
 all MDAs 260 feet and visibility Cats B/C/D and Circling Cats A/B/C $\frac{3}{8}$ SM.

MISSED APPROACH:
Climb to 8300 direct
RSK VORTAC and hold.

ATIS 127.15	DENVER CENTER 118.575 348.7	FARMINGTON TOWER★ 118.9 (CTAF) 0 257.8	GND CON 121.7	UNICOM 122.95
----------------	--------------------------------	---	------------------	------------------

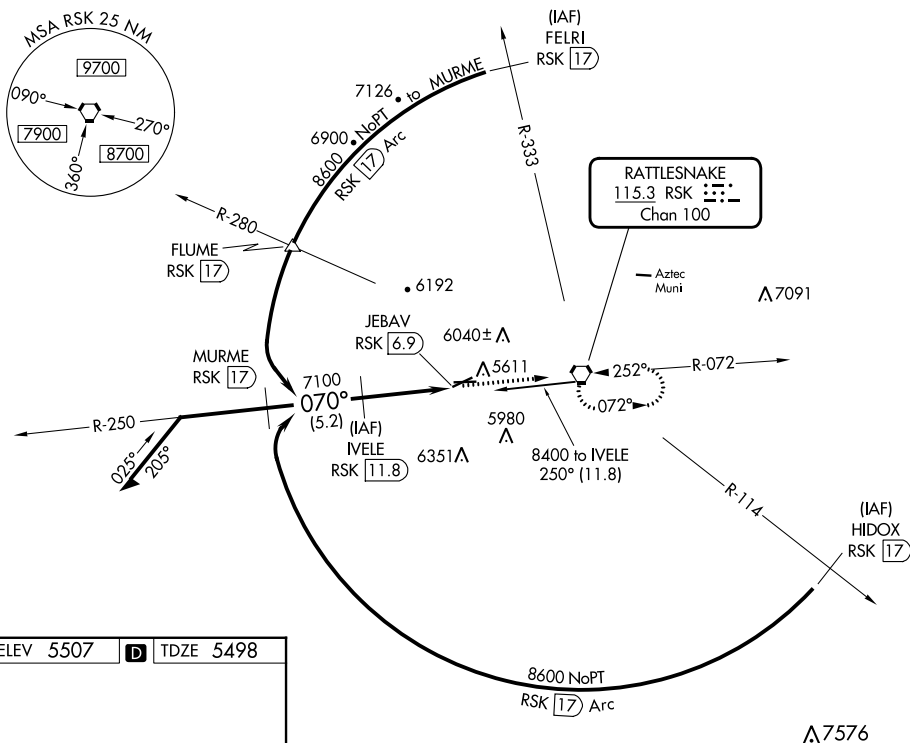


ELEV 5507	D	TDZE 5498
-----------	----------	-----------

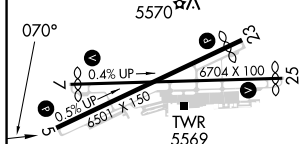

REIL Rwys 23 and 25 **L**
MIRL Rwys 5-23 and 7-25 **L**

FARMINGTON, NEW MEXICO
Orig-B 14JUL22

VGSI and descent angles not coincident
(VGSI Angle 3.00/TCH 42).

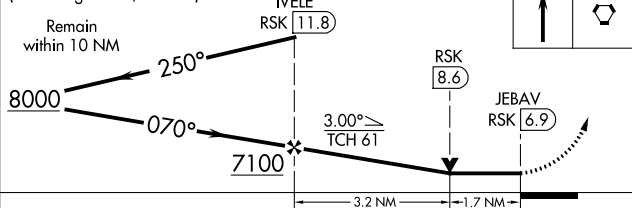

CATEGORY	A	B	C	D
S-5	6060-1	562 (600-1)	6060-1 $\frac{5}{8}$	562 (600-1 $\frac{5}{8}$)
CIRCLING	6100-1 593 (600-1)	6180-1 673 (700-1)	6380-2 $\frac{1}{2}$ 873 (900-2 $\frac{1}{2}$)	6460-3 953 (1000-3)

36°44'N-108°14'W

FOUR CORNERS RGNL (FMN)
VOR/DME RWY 5