


HI-TACAN Y RWY 28



TACAN NGU Chan 86Y	APCH CRS 290°	Rwy ldg TDZE Arpt Elev 7375 14 15	AL-290 [USN]	NORFOLK NS (CHAMBERS FIELD) (KNGU)	
RADAR required.			SSALF	MISSED APPROACH: Climb to 2300 on NGU TACAN R-277 then as directed by ATC.	
* When ALS inop, increase CAT CDE vis to 1 3/8 miles. ** Circling not authorized S of Rwy 10-28.			A4		
ATIS 118.425 338.225	APP CON 118.9 273.475	CHAMBERS TOWER 124.3 379.15		GND CON 121.8 370.85	ASR/PAR

CAUTION:
Do not mistake Norfolk Intl 5 NM SE for
Chambers Fld. Chambers Fld has a single rwy,
Norfolk Intl has int runways.

NORFOLK NS HELIPORT 1 NM NW
Use caution in circling approach.

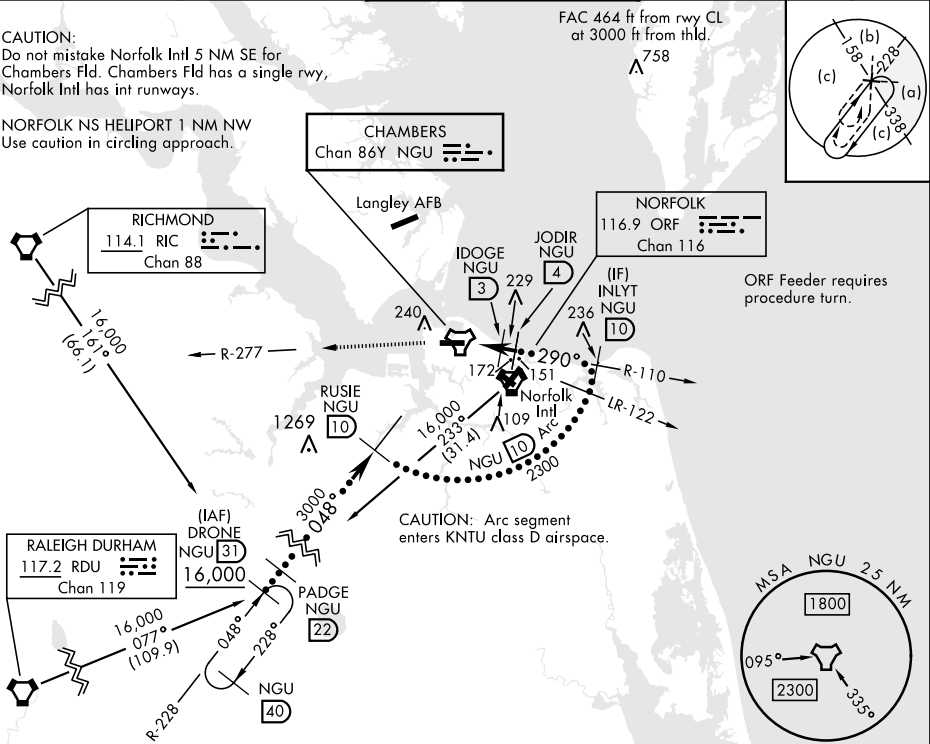

EMERG SAFE ALT 100 NM 4100

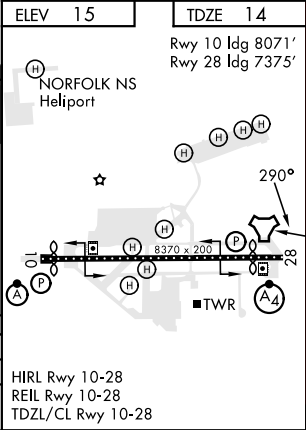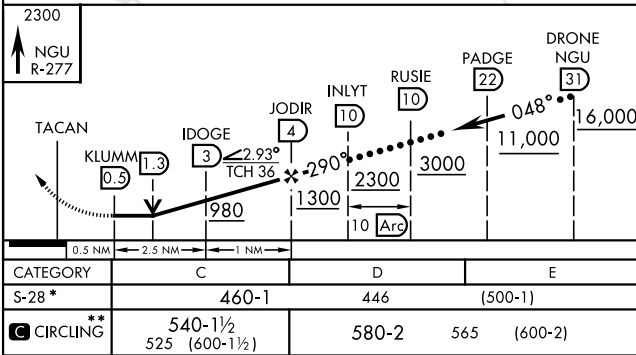

HI-TACAN Y RWY 28