

OZZI ONE ARRIVAL (RNAV) Transition Routes  
 (OZZI.OZZI1) 120CT17  
 ATLANTA, GEORGIA  
 HARTSFIELD-JACKSON ATLANTA INTL (ATL)


D-ATIS ARR  
 119.65  
 ATLANTA APP CON  
 128.525 379.9

DGESS TRANSITION (DGESS.OZZI1): For GSP  
 departures or assigned by ATC only.  
 FLASK TRANSITION (FLASK.OZZI1)  
 LEAVI TRANSITION (LEAVI.OZZI1)  
 MHONY TRANSITION (MHONY.OZZI1): For AVL  
 departures or assigned by ATC only.  
 WINNG TRANSITION (WINNG.OZZI1)

NOTE: RADAR required.  
 NOTE: RNAV 1.  
 NOTE: DME/DME/IRU or GPS required.  
 NOTE: Turbojet aircraft only.  
 NOTE: Landing west: Select Rwy 27L, select ROMMM  
 approach transition; Landing east: Select Rwy 8L.  
 NOTE: Landing Rwy 26R: Select HAINZ approach transition.  
 NOTE: Landing Rwy 26L: Select BOYKN approach transition.  
 NOTE: Landing Rwy 27R: Select MMCAP approach transition.

See following page  
 for Arrival Routes.

OZZI  
 Landing East: Expect 14000  
 Landing West: Expect 12000 and 250K

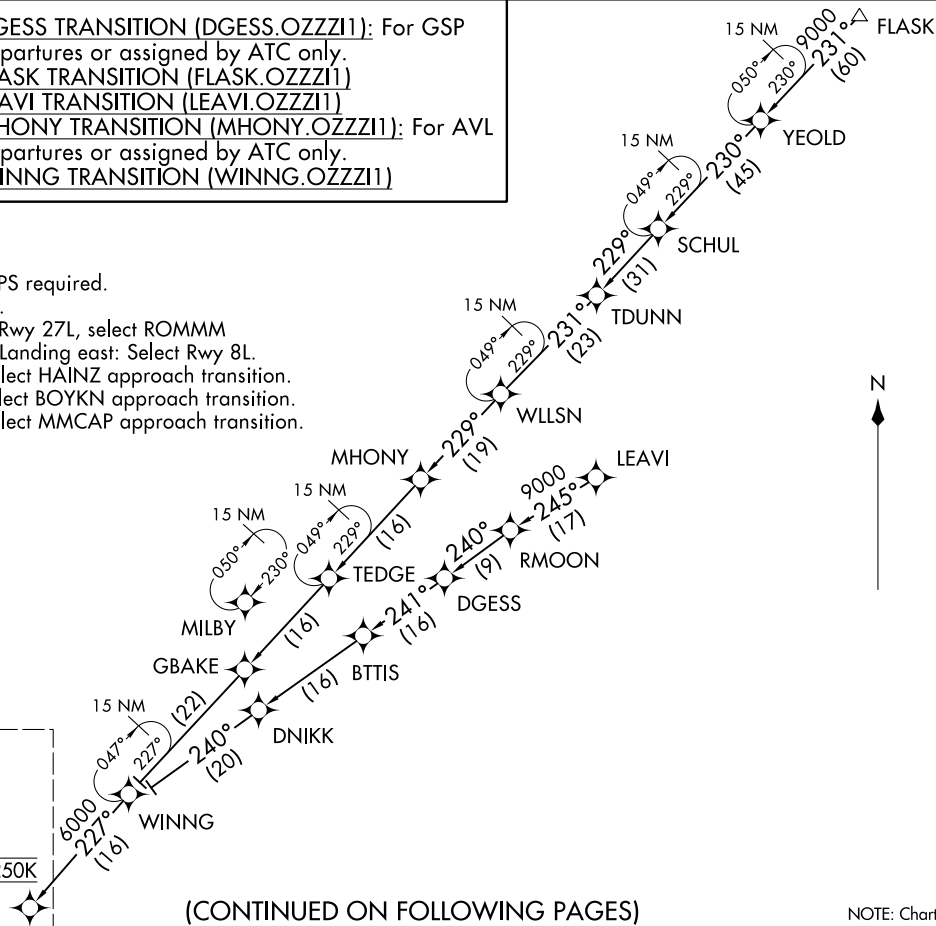


(CONTINUED ON FOLLOWING PAGES)

NOTE: Chart not to scale.

OZZI ONE ARRIVAL (RNAV) Transition Routes  
 (OZZI.OZZI1) 17285  
 ATLANTA, GEORGIA  
 HARTSFIELD-JACKSON ATLANTA INTL (ATL)

NOTE: Chart not to scale.

(NARRATIVE CONTINUED ON FOLLOWING PAGE)

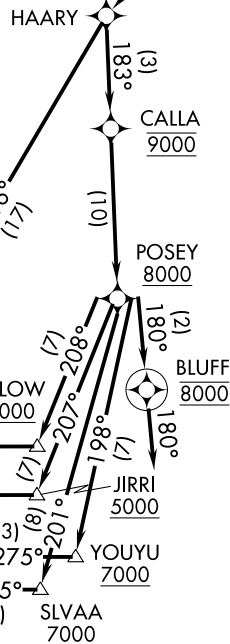

**Routes** ATLANTA, GEORGIA  
HARTSFIELD-JACKSON ATLANTA INTL (ATL)

6 (FAA)    HARTSFIELD-JACKSON ATLANTA INTL (ATL)  
Arrival Routes    ATLANTA, GEORGIA

ARRIVAL DESCRIPTION

From OZZI on track 227° to HAARY.

LANDING RWYS 8L/R: From HAARY on track 216° to KILRR, then on track 275° to GAASS, then on track 275° to KLOWD, then on track 275° to KUNFU, then on track 275° to TRAPE, then on track 275° to SNEVE, then on track 275°. Expect RADAR vectors to final approach course.

LANDING RWYS 9L/R, 10: From HAARY on track 216° to KILRR, then on track 216° to FRYES, then on track 275° to SHURT, then on track 275° to REMAC, then on track 275° to DACTL, then on track 275° to STUMP, then on track 275°. Expect RADAR vectors to final approach course.

LANDING RWY 26L: From HAARY on track 183° to cross CALLA at 9000, then on track 183° to cross POSEY at or above 8000, then on track 207° to cross JIRRI at or above 5000, then on track 275° to cross BOYKN at or above 5000. Expect ILS Rwy 26L approach.

LANDING RWY 26R: From HAARY on track 183° to cross CALLA at 9000, then on track 183° to cross POSEY at or above 8000, then on track 208° to cross ZELOW at or above 5000, then on track 275° to cross HAINZ at or above 5000. Expect ILS Rwy 26R approach.

LANDING RWY 27L: From HAARY on track 183° to cross CALLA at 9000, then on track 183° to cross POSEY at or above 8000, then on track 201° to cross SLVAA at or above 7000, then on track 275° to cross ROMMM at or above 6000. Expect ILS Rwy 27L approach.

LANDING RWY 27R: From HAARY on track 183° to cross CALLA at 9000, then on track 183° to cross POSEY at or above 8000, then on track 198° to cross YOUYU at or above 7000, then on track 275° to cross MMCAP at or above 6000. Expect ILS Rwy 27R approach.

LANDING RWY 28: From HAARY on track 183° to cross CALLA at 9000, then on track 183° to cross POSEY at or above 8000, then on track 180° to cross BLUFF at 8000, then on track 180°. Expect RADAR vectors to final approach course.

LOST COMMUNICATIONS:

LANDING EAST: ASSIGNED RWY 8L OR Rwy NOT ASSIGNED: Cross OZZI at 14000; cross GAASS at 12000, cross KUNFU at or above 7000; cross SNEVE at 5000; after SNEVE turn left direct LARII and proceed on the ILS or RNAV Rwy 8L approach.

LANDING EAST: ASSIGNED RWY 8R: Cross OZZI at 14000; cross GAASS at 12000; cross KUNFU at or above 7000; cross SNEVE at 5000; after SNEVE turn left direct GPEAT and proceed on the ILS or RNAV Rwy 8R approach.

LANDING EAST: ASSIGNED RWY 9L: Cross OZZI at 14000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct RYENN and proceed on the ILS or RNAV Rwy 9L approach.

LANDING EAST: ASSIGNED RWY 9R: Cross OZZI at 14000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct ANDIY and proceed on the ILS or RNAV Rwy 9R approach.

LANDING EAST: ASSIGNED RWY 10: Cross OZZI at 14000; cross FRYES at 12000; cross REMAC at or above 7000; cross STUMP at 4000; after STUMP turn right direct DEWHY and proceed on the ILS or RNAV Rwy 10 approach.

LANDING WEST: ASSIGNED RWY 28: Cross OZZI at 14000; cross CALLA at 9000; cross POSEY at or above 8000; cross BLUFF at 8000; after BLUFF descend to 6000 and proceed direct PRMAN; proceed on the ILS or RNAV Rwy 28 approach.