


ILS or LOC RWY 36R
CHARLOTTE/DOUGLAS INTL (CLT)

MISSED APPROACH: Climb to 1320 then climbing right turn to 4000 on CLT VOR/DME R-093 to LOCAS INT/24.9 DME and hold.

CHARLOTTE
115.0 CLT 
Chan 97

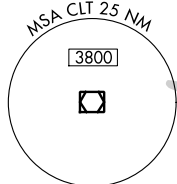

RADAR REQUIRED

	CLT R-093	LOCAS CLT <u>24.9</u>	VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 74).				HEKAM I-BQC <u>17.9</u>
* LOC only.	I-BQC <u>1.5</u>	*I-BQC <u>2.5</u>	2500	3000	4000	5000	6000
	1 NM	4.4 NM	1.6 NM	3.2 NM	3.2 NM	3.2 NM	GS 3.00° TCH 55
CATEGORY S-ILS 36R	A	B	C	D	927/18 200 (200-½)		
S-LOC 36R	1120/24	393 (400-½)	1120/35	393 (400-¾)			
C CIRCLING	1380-1	632 (700-1)	1500-2¼ 752 (800-2¼)	1500-2½ 752 (800-2½)			

SE-2, 18 APR 2024 to 16 MAY 2024