

LOC HLPV 110.3	APP CRS 174°	Rwy Idg 9001 TDZE 32 Apt Elev 33	ILS Z or LOC Z RWY 17R ELLINGTON (EFD)
--------------------------	------------------------	---	---

DME required. RADAR required for procedure entry.

▼



⚠

Circling NA west of Rwy 17R-35L. DME from EFD TACAN. Simultaneous reception of I-LPV and EFD DME required. Inop table does not apply to S-ILS 17R. For inop ALS, increase S-LOC 17R Cats C/D/E visibility to 1½ SM.

MALSF

MISSED APPROACH: Climb to 700 then climbing left turn to 3100 on VUH VOR/DME R-320 to WATFO INT/VUH 9.3 DME and hold (TACAN aircraft climb to 700 then climbing left turn to 3100 on EFD TACAN R-136 to WATFO INT/EFD 16 DME and hold southeast, left turn, 316° inbound).

ATIS 135.575 269.9	HOUSTON APP CON 134.45 284.0	ELLINGTON TOWER 126.05 253.5	GND CON 121.6 275.8
------------------------------	--	--	-------------------------------

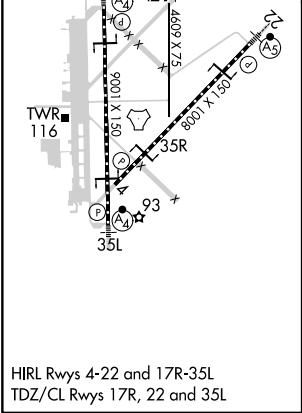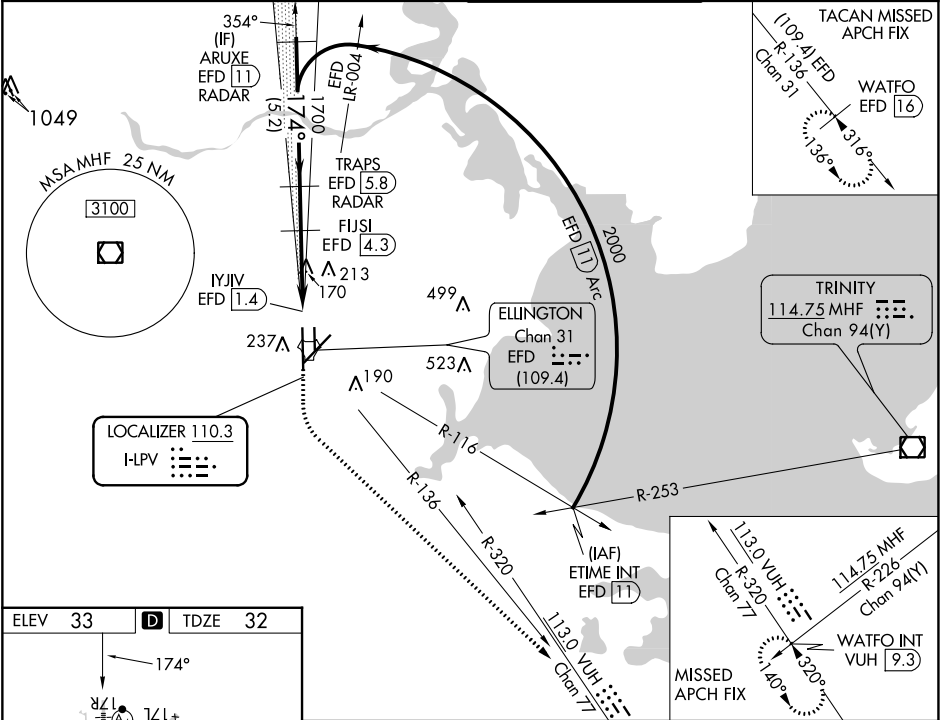

VGSI and ILS glidepath not coincident (VGSI Angle 3.00/TCH 48).

700 3100

VUH

R-320

WATFO INT

*LOC only.

2000 1700

174°

1700

1180

5.2 NM 1.5 NM 2.4 0.7 0.6

CATEGORY	A	B	C	D	E
S-ILS 17R	232/40		200 (200-¾)		
S-LOC 17R	480/40	448 (500-¾)	480/55 448 (500-1)		
CIRCLING	500-1	467 (500-1)	580-1½ 547 (600-1½)	640-2 607 (700-2)	700-2¼ 667 (700-2¼)