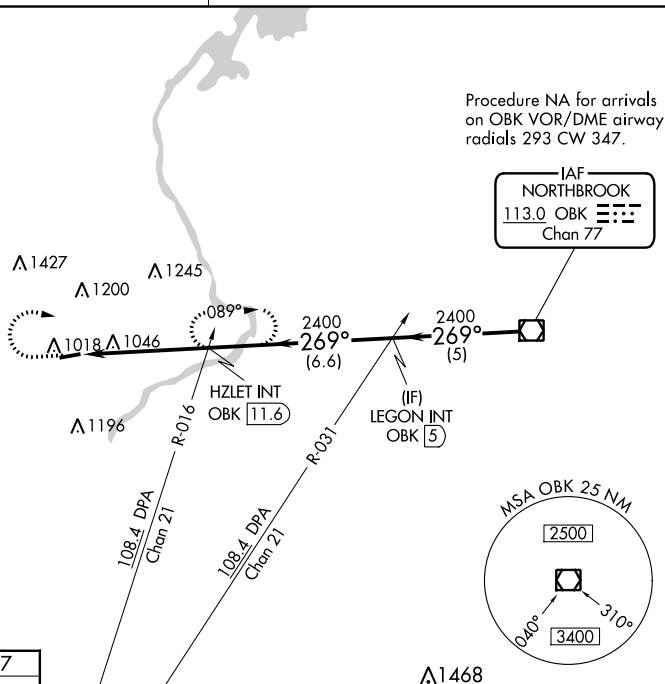
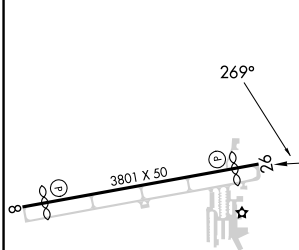


VOR RWY 26
LAKE IN THE HILLS (3CK)

MISSED APPROACH: Climb to 1900, then climbing right turn to 2500 on heading 130° and OBK VOR/DME R-269 to HZLET INT/OBK 11.6 DME and hold.

UNICOM
123.05 (CTAF) 

A1468

LIRL Rwy 8-26 **L**

FAF to MAP 4.7 NM

Knots	60	90	120	150	180
Min:Sec	4:42	3:08	2:21	1:53	1:34

1900 ↑	2500 hdg 130°	OBK R-269	HZLET INT	VGSIs and descent angles not coincident (VGS Angle 3.00/TCH 20).		Procedure Turn NA
			HZLET INT OBK 11.6	LEGON INT OBK 5		OBK VOR/DME
		OBK 16.3			269°	2400

	4.7 NM		6.6 NM		5 NM	
CATEGORY	A	B	C	D		
S-26	1380-1	493 (500-1)	1380-1 $\frac{3}{8}$ 493 (500-1 $\frac{3}{8}$)	NA		
CIRCLING	1380-1	493 (500-1)	1620-2 733 (800-2)	NA		
CHICAGO DUPAGE ALTIMETER SETTING						
S-26	1440-1	553 (600-1)	1440-1 $\frac{5}{8}$ 553 (600-1 $\frac{5}{8}$)	NA		
CIRCLING	1440-1	553 (600-1)	1680-2 $\frac{1}{4}$ 793 (800-2 $\frac{1}{4}$)	NA		