
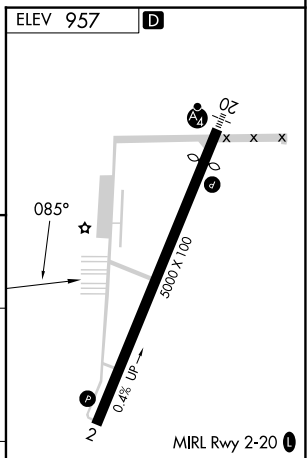
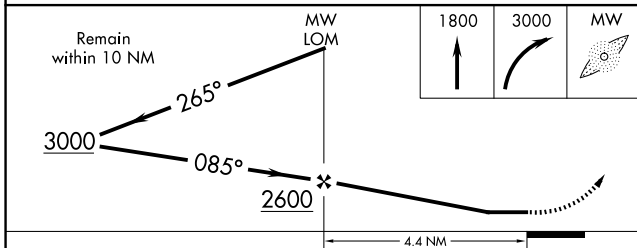
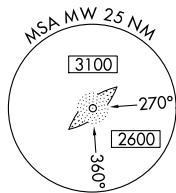


| | | | |
|----------------------|------------------------|-----------------------------|--|
| LOM MW 223 | APP CRS 085° | Rwy Idg TDZE Apt Elev | N/A N/A 957 |
|----------------------|------------------------|-----------------------------|--|

NDB-A
DAYTON/WRIGHT BROTHERS (MGY)

| | | | |
|---|--|---|---|
| RADAR required for procedure entry. | | MISSED APPROACH: Climb to 1800 then climbing right turn to 3000 direct MW LOM and hold. | |
| <p>▼ When local altimeter setting not received, use James M Cox Dayton Intl altimeter setting and increase all MDAs 60 feet, and Cat C/D visibilities ¼ SM.</p> <p>▲ NA</p> | | ASOS 118.375 | COLUMBUS APP CON 118.85 269.275 |
| | | CLNC DEL 119.4 | UNICOM 122.8 (CTAF) 0 |

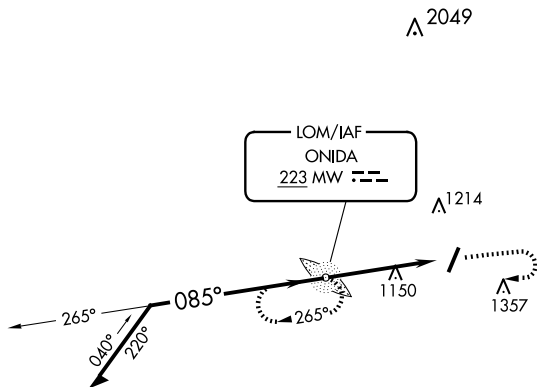

| | | | | | | | | | | |
|----------|-----------------------|-----------------------|-----------------------|-------------------------|-------------------|------|------|------|------|------|
| CATEGORY | A | B | C | D | FAF to MAP 4.4 NM | | | | | |
| CIRCLING | 1480-1 523 (600-1) | 1520-1 563 (600-1) | 1660-2 703 (800-2) | 1660-2¼ 703 (800-2¼) | Knots | 60 | 90 | 120 | 150 | 180 |
| | | | | | Min:Sec | 4:24 | 2:56 | 2:12 | 1:46 | 1:28 |