



LOC/DME I-CBP 109.1 Chan 28	APP CRS 101°	Rwy Idg 8000 TDZE 815 Apt Elev 815
--	------------------------	---

ILS or LOC RWY 10L


JOHN GLENN COLUMBUS INTL (CMH)

DME or RADAR required.		MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct APE VORTAC and hold.		
<p>Simultaneous approach authorized. For inop ALS, increase S-LOC 10L Cat C/D visibility to 1 1/2 SM. * RVR 1800 authorized with the use of FD or AP or HUD to DA.</p>					

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC
------------------------	---	--------------------------------------	-------------------------------	--------------------------	-------

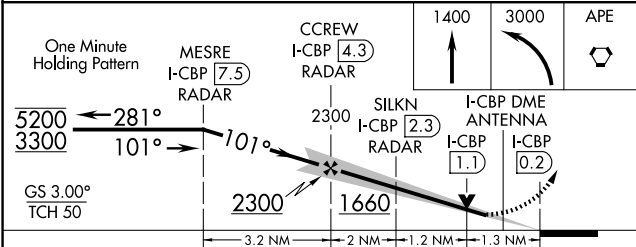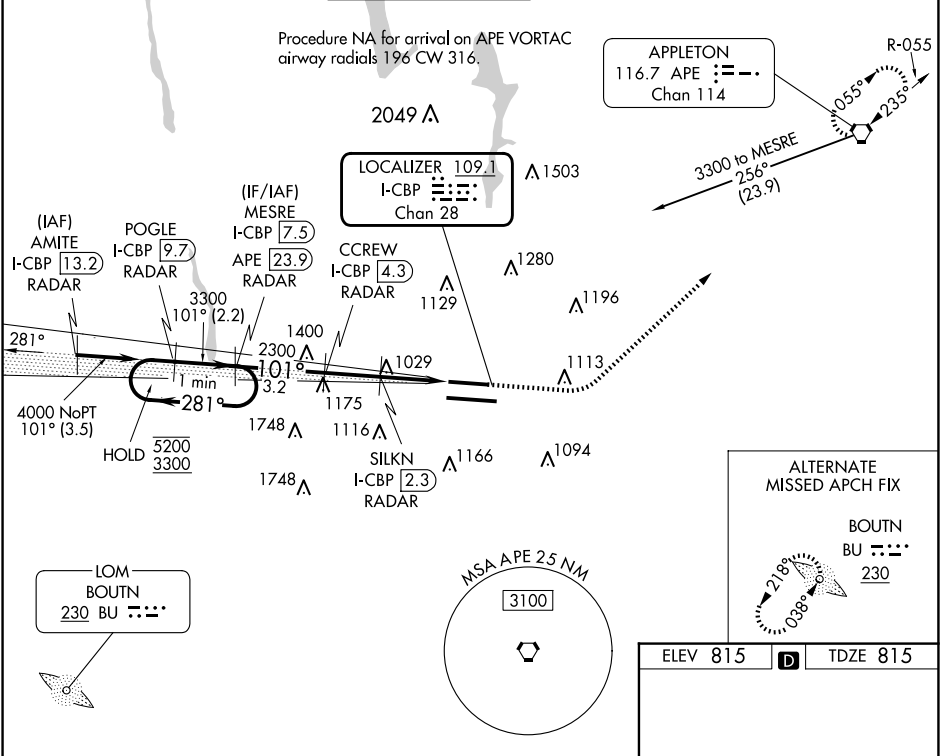

ELEV 815	D	TDZE 815
----------	---	----------

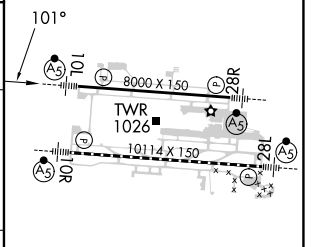

CATEGORY	A	B	C	D
S-ILS 10L*	1015/24 200 (200-1/2)			
S-LOC 10L	1280/24	465 (500-1/2)	1280/50	465 (500-1)
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)

TDZ/CL Rwy 10R-28L	60	90	120	150	180
HRL Rwys 10R-28L and 10L-28R	4:30	3:00	2:15	1:48	1:30
FAF to MAP 4.5 NM					

EC-2, 20 MAR 2025 to 17 APR 2025

EC-2, 20 MAR 2025 to 17 APR 2025