
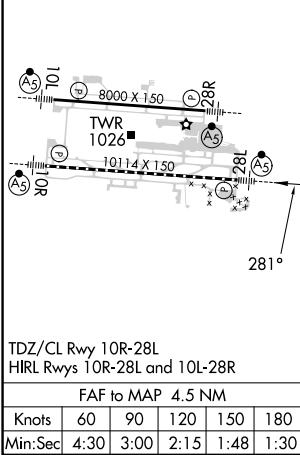


LOC/DME I-CMH 111.75	APP CRS 281°	Rwy Idg 10113
Chan 54 (Y)		TDZE 815
		Apt Elev 815

ILS or LOC RWY 28L

JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.			MALSR			MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.		
<p> Simultaneous approach authorized.</p> <p> For inop ALS, increase S-LOC 28L Cat C/D visibility to 1 1/2 SM.</p>								
D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6	CLNC DEL 126.3	CPDLC			

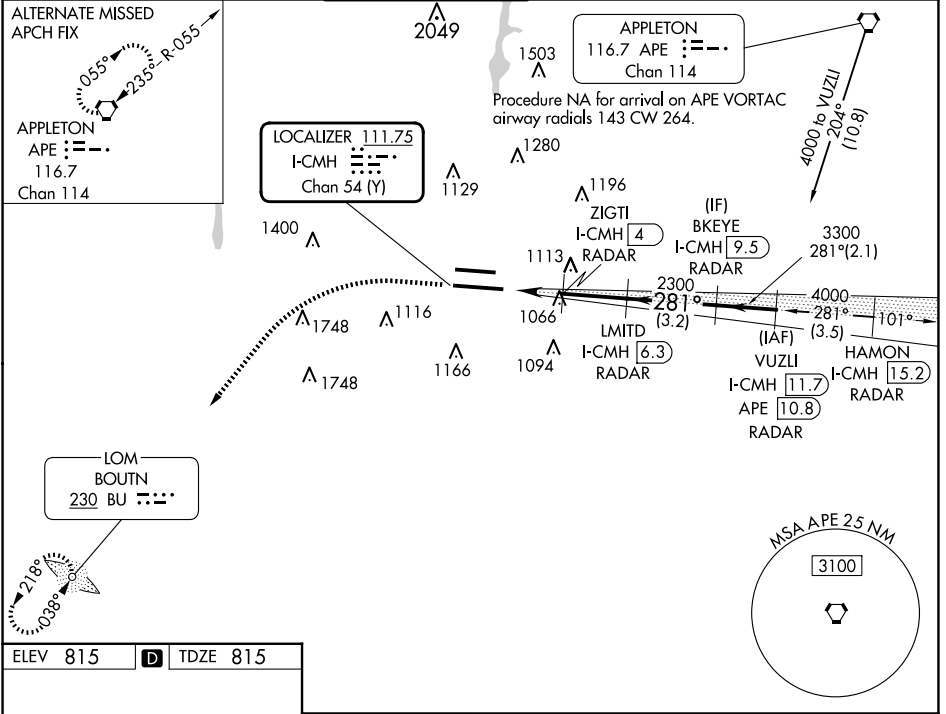

TDZ/CL Rwy 10R-28L	1015/18 200 (200-1/2)			
HIRL Rwys 10R-28L and 10L-28R	1015/18 200 (200-1/2)			
FAF to MAP 4.5 NM	1015/18 200 (200-1/2)			
Knots	60	90	120	150
Min:Sec	4:30	3:00	2:15	1:48
CIRCLING	1340-1	525 (600-1)	1520-2 705 (800-2)	1520-2 1/4 705 (800-2 1/4)

EC-2, 20 MAR 2025 to 17 APR 2025

EC-2, 20 MAR 2025 to 17 APR 2025