

TAMPA, FLORIDA

AL-416 (FAA)

24305


LOC/DME I-TPA 110.3 Chan 40	APP CRS 187°	Rwy Idg 8300 TDZE 26 Apt Elev 26
--	------------------------	---

ILS RWY 19L (CAT II)



TAMPA INTL (TPA)

RAIDR required for procedure entry. Simultaneous approach authorized. RVR 1000 authorized with specific OPSPEC, MSPEC, or LOA approval and use of autoland or HUD to touchdown.		ALSF-2 	MISSED APPROACH: Climb to 600 then climbing left turn to 2800 on heading 160° and on PIE VORTAC R-138 to GIBBS INT/PIE 29.3 DME and hold.
--	--	------------	--

ARR 126.45	D-ATIS 128.475	DEP 118.5 307.175	TAMPA APP CON 119.5 269.4	TAMPA TOWER 119.5 269.4	GND CON 121.7 269.4	CLNC DEL 133.6	CPDLC
----------------------	--------------------------	-----------------------------	-------------------------------------	-----------------------------------	-------------------------------	--------------------------	-------

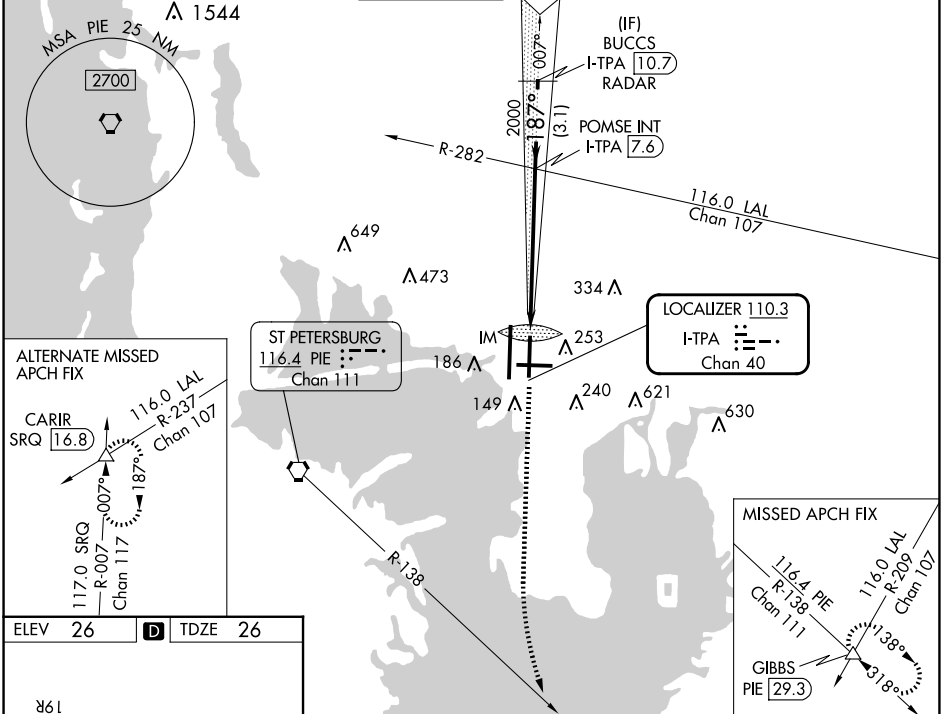

ELEV 26	D	TDZE 26
---------	----------	---------

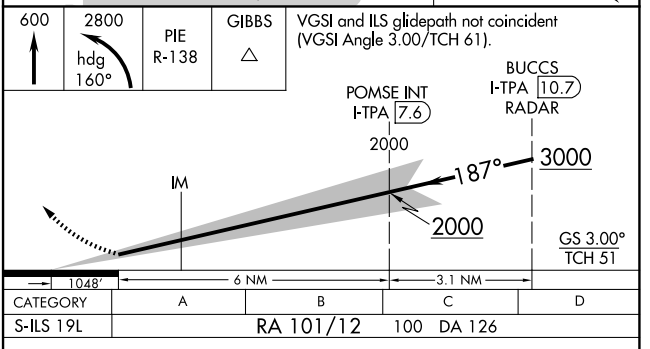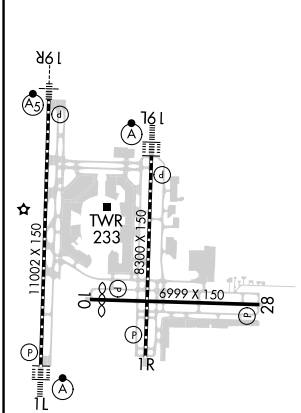

REIL Rwy 1R	TDZ/CL Rwy 1L and 19L	HIRL Rwy 1L-19R, 1R-19L, and 10-28
CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED		

TAMPA, FLORIDA
Amdt 41 20APR23

27°59'N-82°32'W

TAMPA INTL (TPA)

ILS RWY 19L (CAT II)

SE-3, 20 MAR 2025 to 17 APR 2025

SE-3, 20 MAR 2025 to 17 APR 2025