


LOC/DME I-CMH	APP CRS	Rwy Idg	10113
111.75	281°	TDZE	815
Chan 54 (Y)		Apt Elev	815


ILS or LOC RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required.	MALSR	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.
Simultaneous approach authorized.		
For inop ALS, increase S-LOC 28L Cat C/D visibility to 1½ SM.		

D-ATIS	COLUMBUS APP CON	COLUMBUS TOWER	GND CON	CLNC DEL	CPDLC
124.6	125.95 371.975	132.7 257.8	121.9 348.6	126.3	

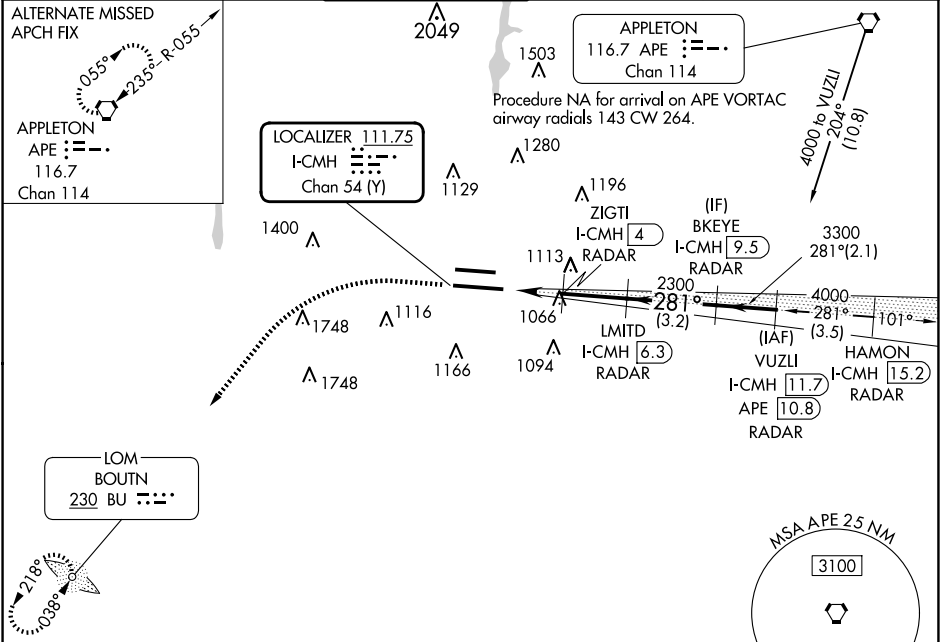

ELEV 815	TDZE 815
----------	----------

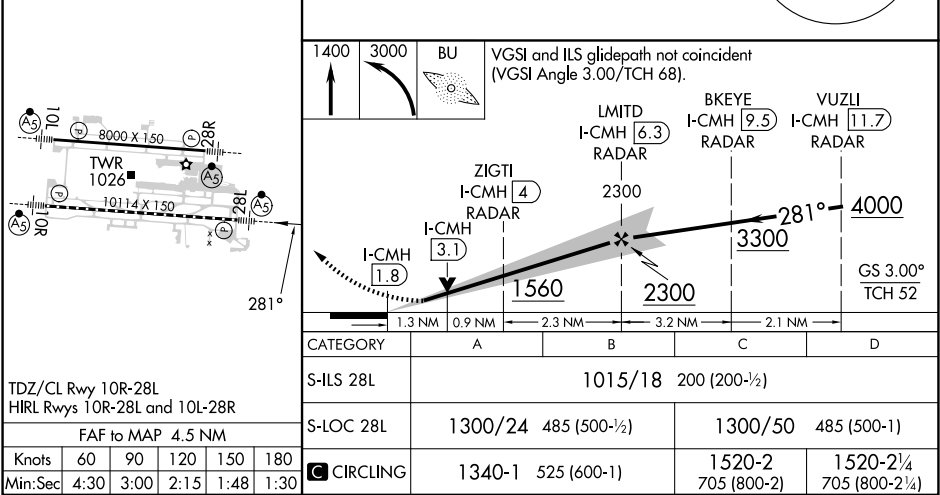

COLUMBUS, OHIO						JOHN GLENN COLUMBUS INTL (CMH)					
Amdt 31 22APR21						40°00'N-82°54'W					
ILS or LOC RWY 28L						ILS or LOC RWY 28L					