

25219

WAAS CH 78007 W33A	APP CRS 330°	Rwy Ldg 11440 TDZE 163 Apt Elev 192
--	------------------------	--

RNAV (GPS) RWY 33
BANGOR INTL (BGR)

RNP APCH.

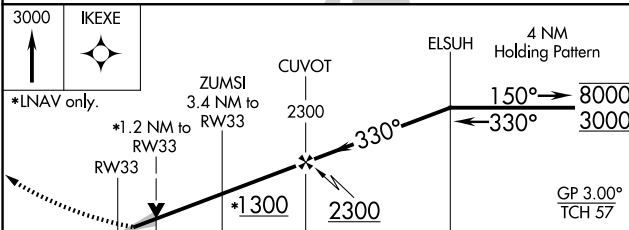

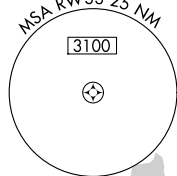
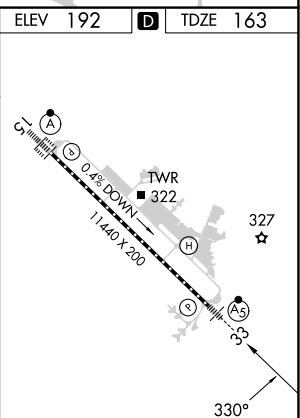
ASR Circling NA northeast of Rwy's 15 and 33. For uncompensated Baro-VNAV systems, LNAV/VNAV or LNAV below -18°C or above 54°C. For inop ALS, increase LPV Cat E visibility to RVR 4000, LNAV/VNAV Cat E visibility to RVR 5500, and LNAV Cat E visibility to 1½ SM.
 **RVR 1800 authorized with use of FD or AP or HUD to DA.

MALSR

MISSED APPROACH:
Climb to 3000 direct
IKEXE and hold.

ATIS 127.75	BANGOR APP CON 118.925 239.3	BANGOR TOWER 120.7 233.7	GND CON 121.9 348.6	CLNC DEL 135.9 348.6
----------------	---------------------------------	-----------------------------	------------------------	-------------------------

MISSED APCH FIX

[illegible]

TDZ/CL Rwy 15
HIRL Rwy 15-33

BANGOR, MAINE
Amdt 1A 20JUN19

44°48'N-68°50'W

BANGOR INTL (BGR)
RNAV (GPS) RWY 33

NE-1, 27 NOV 2025 to 25 DEC 2025

NE-1, 27 NOV 2025 to 25 DEC 2025