

APP CRS	Rwy Ldg	7569
055°	TDZE	708
	Apt Elev	727

RNAV (RNP) Z RWY 5

BUFFALO NIAGARA INTL (BUF)


⚠

For uncompensated Baro-VNAV systems, procedure NA below -18°C (0°F) or above 54°C (130°F). GPS required. For inoperative MALSR, increase RNP 0.10 all Cats visibility to 1¼. For inoperative MALSR, increase RNP 0.30 all Cats visibility to 1½.

MALSR

MISSED APPROACH: Climb to 3000 on the RNAV missed approach route to TRAVA and hold.

D-ATIS	BUFFALO APP CON	BUFFALO TOWER	GND CON
135.35	126.15 263.125	120.5 257.8	133.2 257.8

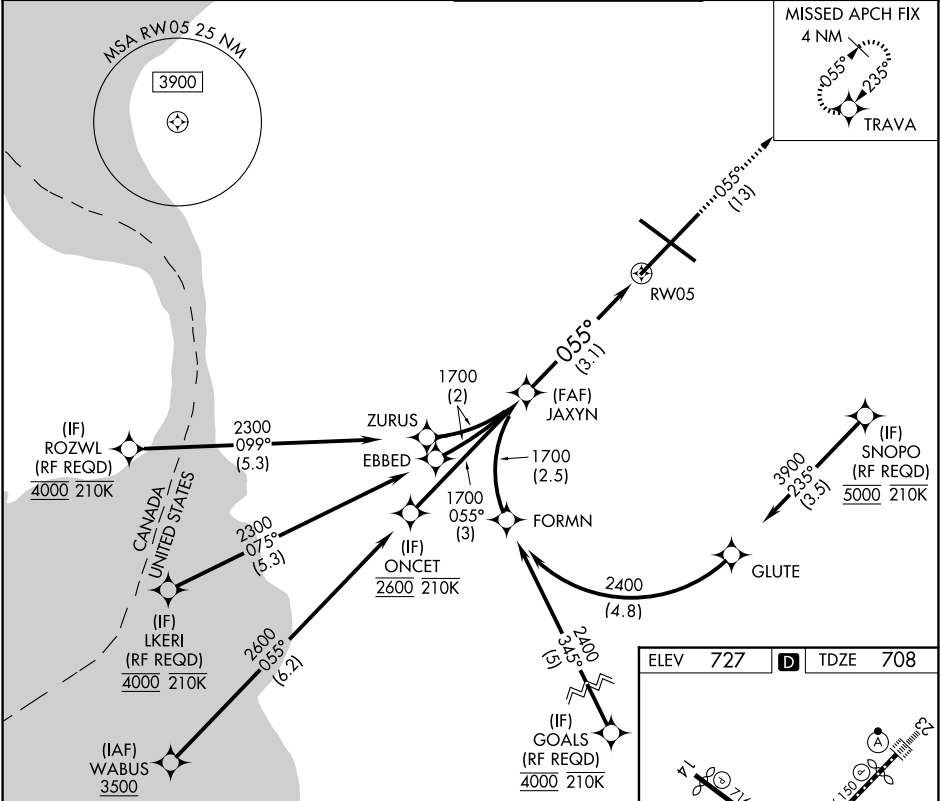

JAXYN

See planview for multiple IF locations

3000

TRAVA

1700

GP 3.00° TCH 46

055°

RW05

3.1 NM

CATEGORY	A	B	C	D
RNP 0.10 DA	1065/45 357 (400-¾)			
RNP 0.30 DA	1159/60 451 (500-1¼)			

AUTHORIZATION REQUIRED

ELEV 727 D TDZE 708

REIL Rwy 14
TDZL/RCLS Rwy 5 and 23
HIRL Rwy 5-23 and 14-32