
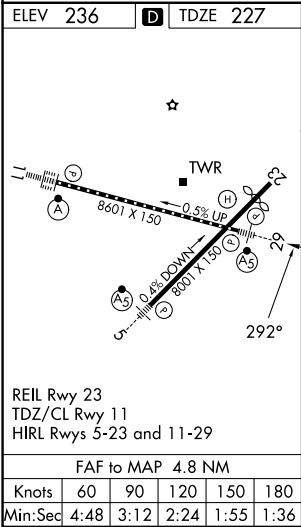


LOC I-VYK 108.3	APP CRS 292°	Rwy Ldg TDZE Apt Elev 8506 227 236
---------------------------	------------------------	--

ILS or LOC RWY 29
COLUMBIA METRO (CAE)

RADAR required for procedure entry. For inop ALS, increase S-ILS 29 Cat E visibility to RVR 4000, and S-LOC 29 Cats C/D/E to 1½ SM. *RVR 1800 authorized with use of FD or AP or HUD to DA. MALSRL 	MISSED APPROACH: Climb to 1000 then climbing left turn to 2300 direct CAE VORTAC and hold, continue climb-in-hold to 2300. (TACAN aircraft continue on CAE VORTAC R-140 to ADCOM INT/10 DME and hold NW, right turn, 140° inbound).
---	---

ATIS 120.15	COLUMBIA APP CON 124.15 338.2 (110°-289°) 133.4 285.6 (290°-109°)	COLUMBIA TOWER 119.5 257.8	GND CON 121.9 348.6
-----------------------	---	--------------------------------------	-------------------------------

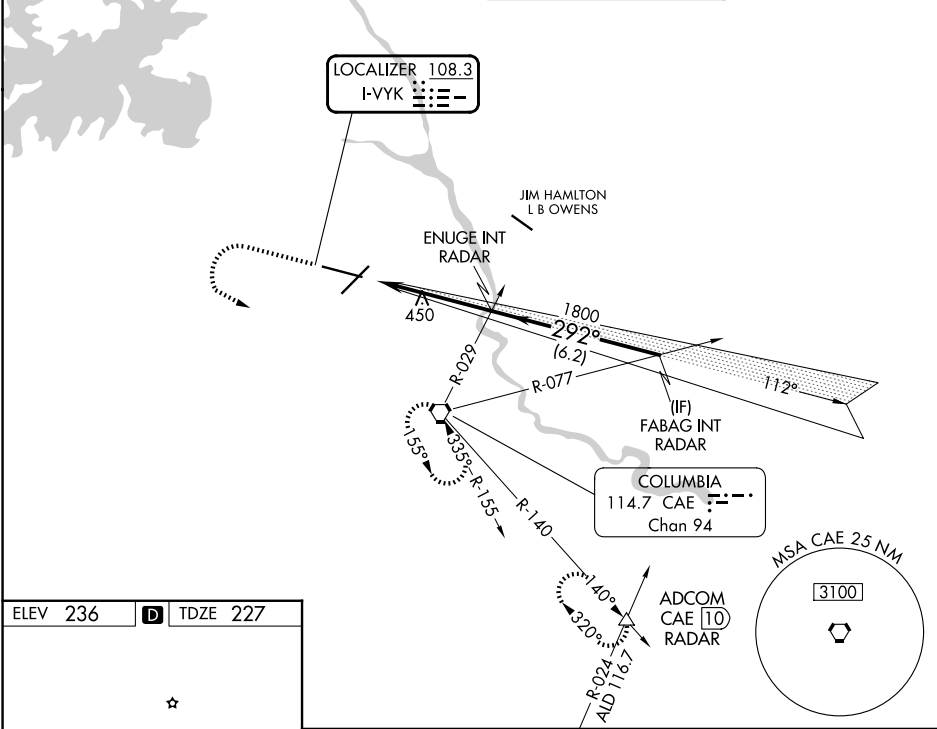

1000	2300	CAE						
↑	↷	⬡						
			ENUGE INT RADAR			FABAG INT RADAR		
			1800	292°		2500		
			1800			GS 3.00°	TCH 58	
			4.8 NM	6.2 NM				
CATEGORY	A	B	C	D	E			
S-ILS 29*	427/24 200 (200-½)							
S-LOC 29	700/24	473 (500-½)	700/50		473 (500-1)			
CIRCLING	740-1 504 (600-1)	860-1 624 (700-1)	1040-2¼ 804 (900-2¼)	1040-2½ 804 (900-2½)	1040-2¾ 804 (900-2¾)			

SE-2, 27 NOV 2025 to 25 DEC 2025

SE-2, 27 NOV 2025 to 25 DEC 2025