


LOC/DME I-CMH 111.75 Chan 54 (Y)	APP CRS 281°	Rwy Ldg TDZE 815 Apt Elev 815
--	------------------------	---

ILS or LOC RWY 28L
JOHN GLENN COLUMBUS INTL (CMH)

ADF required. DME or RADAR required. Simultaneous approach authorized. For inop ALS, increase S-LOC 28L Cat C/D visibility to 1½ SM.	MALSR 	MISSED APPROACH: Climb to 1400 then climbing left turn to 3000 direct BU LOM and hold.
--	-----------	--

D-ATIS 124.6	COLUMBUS APP CON 125.95 371.975	COLUMBUS TOWER 132.7 257.8	GND CON 121.9 348.6
------------------------	---	--------------------------------------	-------------------------------

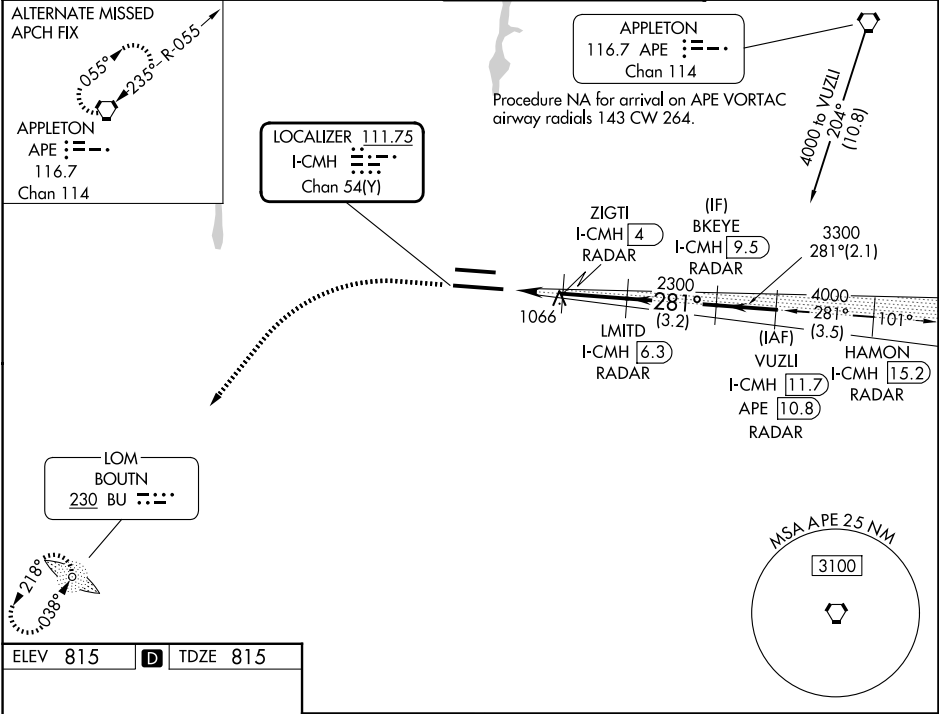

ELEV 815	D	TDZE 815
-----------------	----------	-----------------

