

GOLDSBORO, NORTH CAROLINA

TACAN Y RWY 26

TACAN GSB
Chan 112

APCH CRS
261°

Rwy ldg 11,760
TDZE 109
Arpt Elev 109

[USAF]

SEYMOUR JOHNSON AFB (KGSB)

▼ * When ALS inop, increase CAT AB RVR to 55, vis to 1 mile, CAT CDE vis to 1¼ miles.
** Circling N of Rwy 8-26 not authorized.

ALSF-1
A1

MISSED APPROACH: Climb to 2200 via GSB R-261 to TULME and hold.


ATIS ★
317.625

APP CON
123.7 290.9 (258°-110°)
119.7 273.6 (111°-257°)

TOWER ★
126.25 370.875

GND CON
132.45 275.8

CLNC DEL
128.025 270.8

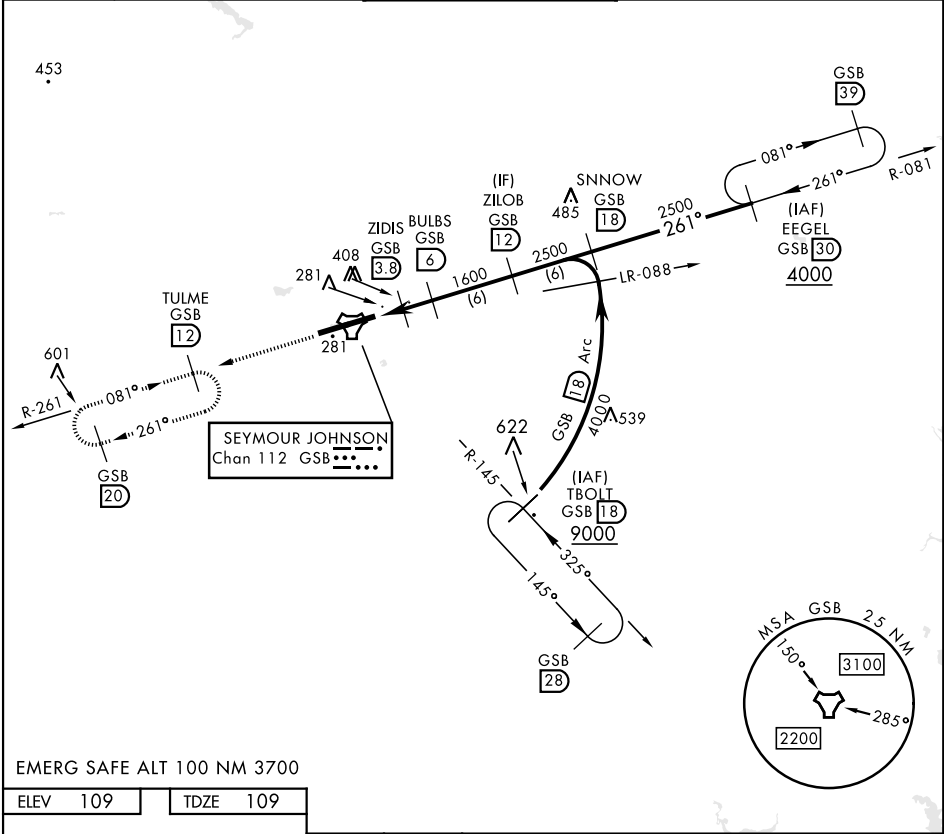

ELEV 109

TDZE 109

TWR

11,760 x 300

0.3% DOWN

261°

A1

2200

GSB R-261

TULME R-261 12

TACAN

COMOZ 2.1

ZIDIS 3.8

BULBS 6

2500

1600

880

3.04°

TCH 55

0.6

1.7 NM

2.2 NM

CATEGORY	A	B	C	D	E
S-26 *	540/24	431 (500-½)	540/40	431 (500-¾)	
CIRCLING **	580-1 471 (500-1)	600-1 491 (500-1)	680-1½ 571 (600-1½)	740-2 631 (700-2)	740-2¼ 631 (700-2¼)

HIRL Rwy 8-26

GOLDSBORO, NORTH CAROLINA

35° 20'N-77° 58'W

SEYMOUR JOHNSON AFB (KGSB)

Amtd 8 03NOV22

TACAN Y RWY 26

SE-2, 27 NOV 2025 to 25 DEC 2025

SE-2, 27 NOV 2025 to 25 DEC 2025