

25331

ILS RWY 35L (SA CAT I)

LOUISVILLE MUHAMMAD ALI INTL (SDF)


RADAR required.

T Simultaneous approach authorized.
Requires specific OPSPEC, MSPEC, or LOA approval.


ALSF-2

MISSED APPROACH: Climb to 1000 then climbing left turn to 4000 on heading 240° and III VORTAC R-279 to DAMEN INT/ III 24.5 DME and hold.

D-ATIS 118.725	LOUISVILLE APP CON 132.075 327.0	LOUISVILLE TOWER 124.2 257.8	GND CON 121.7 348.6
-------------------	-------------------------------------	---------------------------------	------------------------

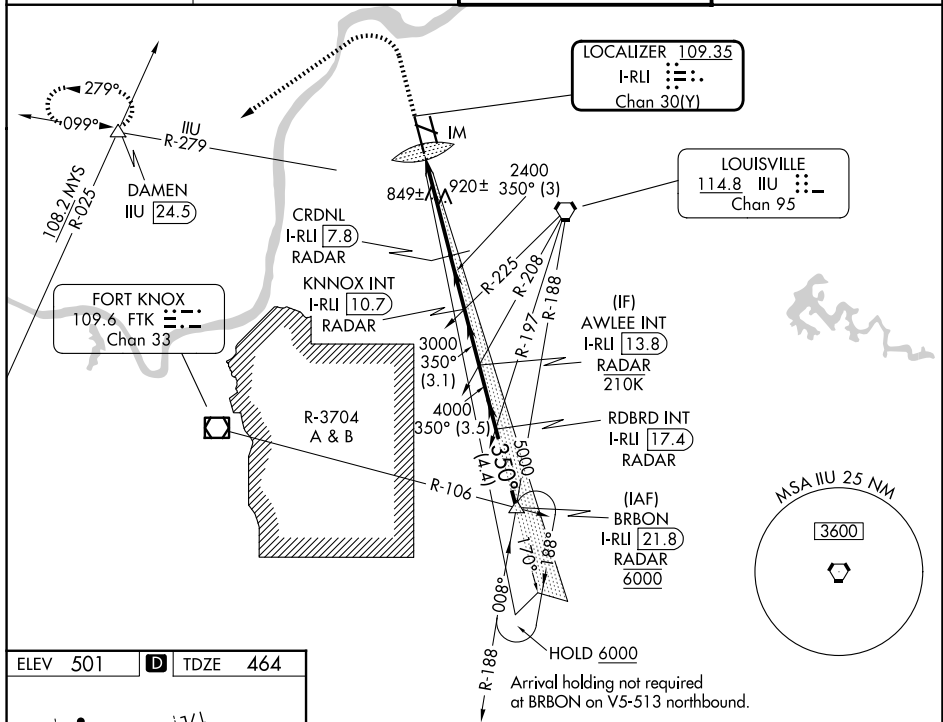

ELEV 501	D	TDZE 464
----------	----------	----------

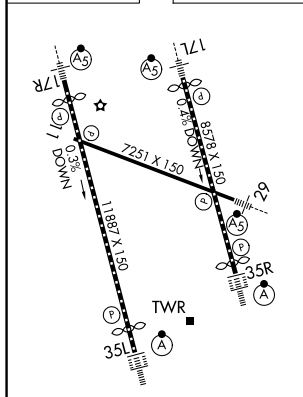

HIRL all Rwys
TDZL/RCLS Rwys 17L, 17R, 35L,
and 35R

1000 ↑ hdg 240°	4000 R-279	ILU R-279	DAMEN △	VGSI and ILS glidepath not coincident (VGSI Angle 3.00°/TCH 75).				AWLEE INT I-RLI 13.8 RADAR
				CRDNL I-RLI 7.8 RADAR 2400 2400 3000 350° 4000 GS 3.00° TCH 59				
CATEGORY	A		B		C		D	
S-ILS 35L	RA 154/14 150 DA 614							

SA CATEGORY I ILS - SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

LOUISVILLE MUHAMMAD ALI INTL (SDF)

38°10'N-85°44'W

ILS RWY 35L (SA CAT I)