
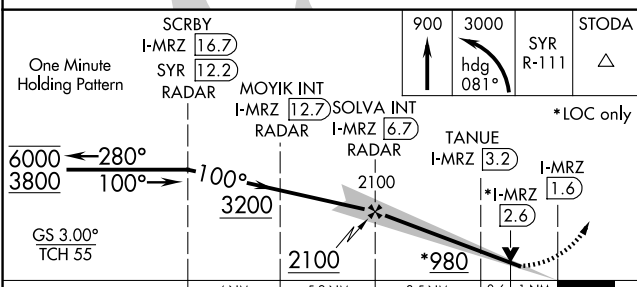


LOC/DME I-MRZ 109.9 Chan 36	APP CRS 100°	Rwy Ldg TDZE 421 Apt Elev 421	9013
---	------------------------	---	-------------

ILS or LOC RWY 10
SYRACUSE HANCOCK INTL (SYR)

DME or RADAR required.	MALSR 	MISSED APPROACH: Climb to 900 then climbing left turn to 3000 on heading 081° and on SYR VORTAC R-111 to STODA INT/ SYR VORTAC 15.5 DME/RADAR and hold.
 TANUE fix minimums, for inoperative ALS, increase S-LOC 10 Cats C and D visibility to RVR 5500. **RVR 1800 authorized with use of FD or AP or HUD to DA.		

ATIS 124.225	SYRACUSE APP CON 126.125 269.125	SYRACUSE TOWER 120.3 239.0	GND CON 121.7 348.6
------------------------	--	--------------------------------------	-------------------------------

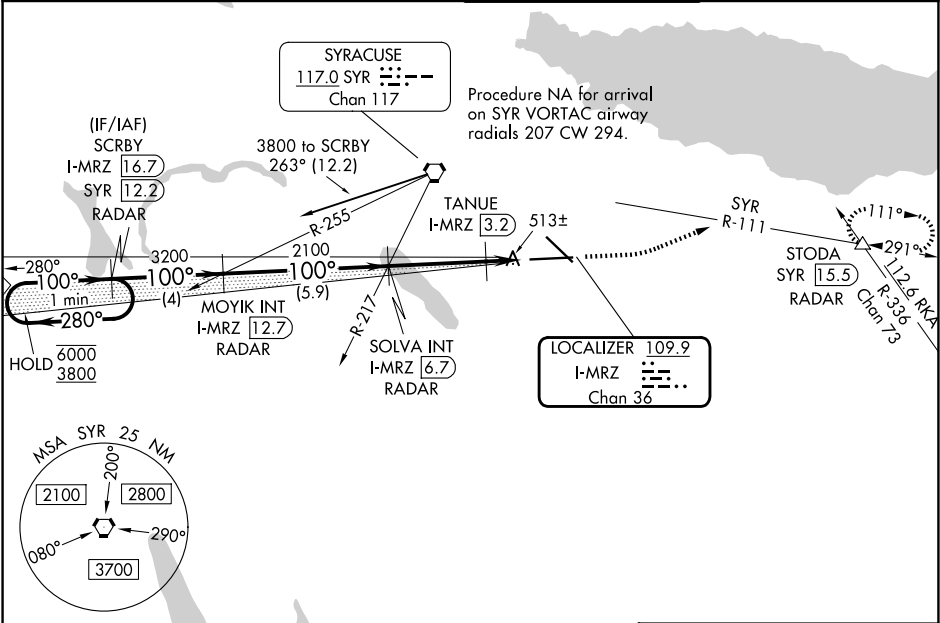

ELEV 421	D TDZE 421
*LOC only	
TANUE FIX MINIMUMS (DME REQUIRED)	
S-LOC 10	780/24 359 (400-½)
CIRCLING	900-1 479 (500-1)
TANUE FIX MINIMUMS (DME REQUIRED)	
S-LOC 10	780/24 359 (400-½)
CIRCLING	900-1 479 (500-1)
TANUE FIX MINIMUMS (DME REQUIRED)	
S-LOC 10	780/24 359 (400-½)
CIRCLING	900-1 479 (500-1)
TANUE FIX MINIMUMS (DME REQUIRED)	
S-LOC 10	780/24 359 (400-½)
CIRCLING	900-1 479 (500-1)