

LOC/DME I-TGN 109.9 Chan 36	APP CRS 074°	Rwy Ldg 10600 TDZE 128 Apt Elev 151
---	------------------------	--

ILS or LOC RWY 7L

TED STEVENS ANCHORAGE INTL (ANC)(PANC)

DME required.




For inop ALS, increase S-ILS 7L Cat E visibility to RVR 4000, S-LOC 7L Cats C, D and E visibility to RVR 5500.



MISSED APPROACH: Climb to 600 then climbing right turn to 3000 on heading 230° and TED VOR/DME R-210 to JUKEP/TED 15 DME and hold. (TACAN aircraft climb to 600 then climbing right turn to 3000 on heading 230° on EDF TACAN R-210 to JUKEP/EDF 22.6 DME and hold).

D-ATIS 135.5	ANCHORAGE APP CON 118.6 290.5	ANCHORAGE TOWER 118.3 257.8	GND CON 121.9 338.25	CLNC DEL 119.4 323.1
------------------------	---	---------------------------------------	--------------------------------	--------------------------------

ALTERNATE MISSED
APCH FIX 28

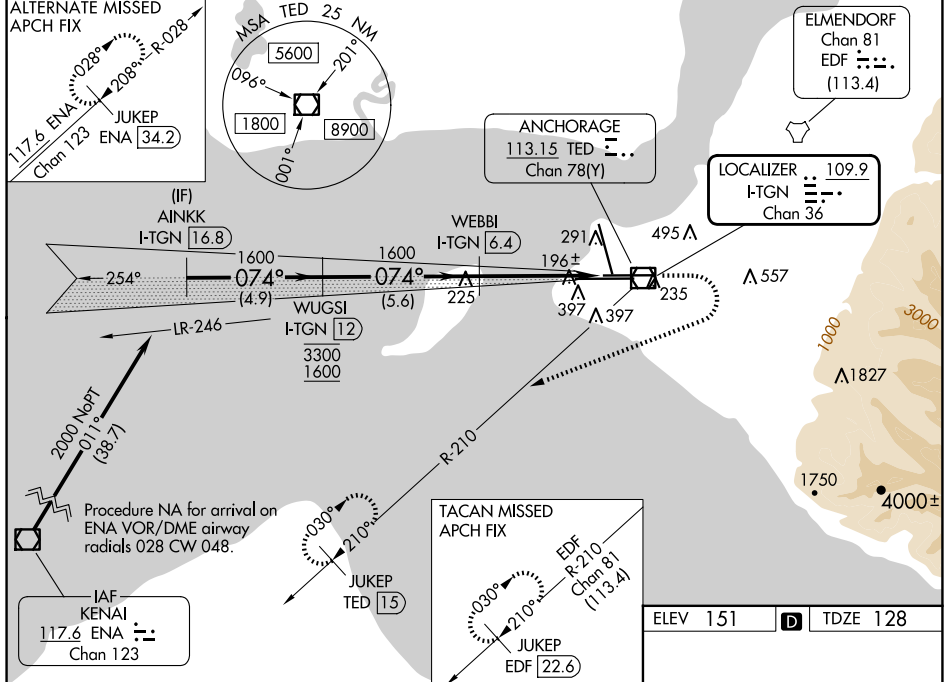

VGSI and ILS glidepath not coincident.
(VGSI Angle 3.00/TCH 63).


AINKK I-TGN 16.8
WUGSI I-TGN 12
WEBBI I-TGN 6.4

2000 074°
3300 1600
1600

GS 3.00°
TCH 54

4.9 NM 5.6 NM 3.5 NM 1 NM

600 3000
↑ hdg 230°
TED T-210 JUKEP TED 15

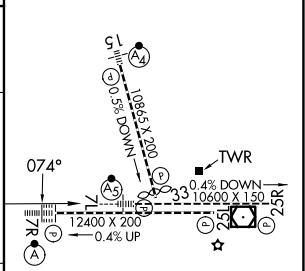

ANCHORAGE, ALASKA
Amdt 5 05OCT23

TED STEVENS ANCHORAGE INTL (ANC)(PANC)

ILS or LOC RWY 7L

61°10'N-150°00'W