

YIGO, GUAM I, GUAM

TACAN Y RWY 24R

VORTAC UNZ 115.8 Chan 105	APCH CRS 234°	Rwy Idg 10,527 TDZE 617 Arpt Elev 617
---	-------------------------	--

(USAF)

ANDERSEN AFB (PGUA)

RNAV or RADAR required for missed approach			
--	--	--	--


T * When ALS inop increase CAT AB RVR to 55, vis to 1 mile; CAT CDE RVR to 50, vis to 1 mile.
** Circling not authorized NW of Rwy 06L-24R.

MISSED APPROACH: Climb to 1100, then climbing left turn to intercept UNZ R-054 to MDBUG and hold.

ATIS 118.175 254.325	GUAM APP CON/DEP CON 119.8 269.0	TOWER 126.2 233.7	GND CON 121.7 275.8
-------------------------	-------------------------------------	----------------------	------------------------

CAUTION: Environmentally Sensitive Area Flights along Andersen cliff line restricted to 1000' AGL or above.

All touchdown zones have a 1.0% down slope.

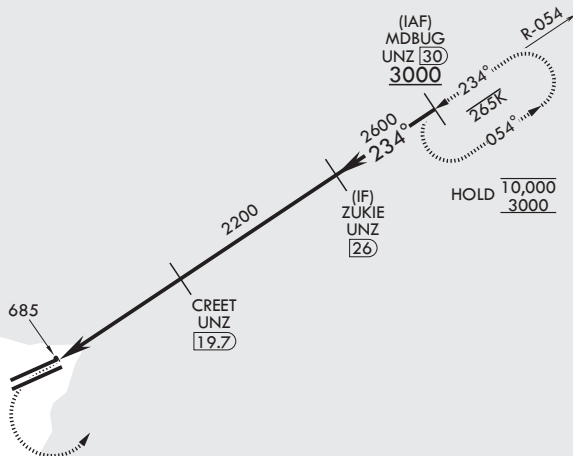


HOLD 10,000
3000

MSA UNZ 25 NM

1000

EMERG SAFE ALT 100 NM 2900

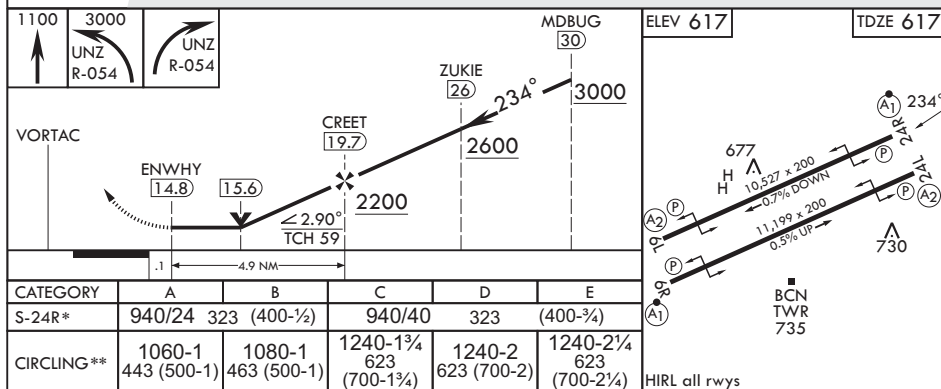

YIGO, GUAM I, GUAM

13°35'N - 144°56'E

ANDERSEN AFB (PGUA)

Amdt 3 10AUG23
TERPS

TACAN Y RWY 24R

PAC, 27 NOV 2025 to 22 JAN 2026

PAC, 27 NOV 2025 to 22 JAN 2026