

WAAS CH 93511 W02A	APP CRS 023°	Rwy Ldg 6005 TDZE 433 Apt Elev 433
--	------------------------	---

APP CRS
023°

Rwy Ldg	6005
TDZE	433
Apt Elev	433

RNAV (GPS) RWY 2
JACKSON RGNL (MKL)

JACKSON RGNI (MKT.)

RNP APCH - GPS.

T For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -15°C or above 48°C.
A For inop ALS, increase visibility LNAV Cats A/B to 1 SM, and Cats C/D to 1 3/8 SM.

MALSR



MISSED APPROACH:
Climb to 3000 direct
GARTZ and hold.

ASOS
119,325

MEMPHIS CENTER
134.65 316.15

JACKSON TOWER ★
127.15 (CTAF) **L** 249.95

GND CON
120.9


UNICOM
122.95

MISSED APCH FIX

4 NM -



GARTZ

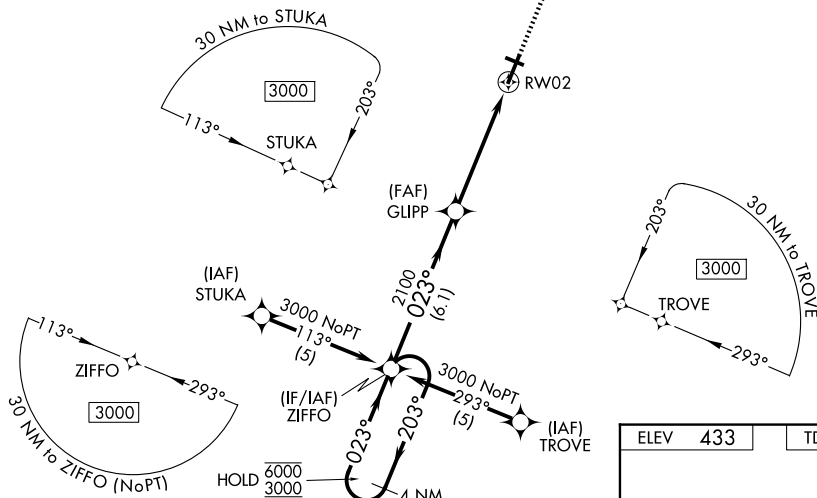

ELEV	433
------	-----

TDZE 433

4 NM	VGSI and RNAV glidepath not coincident
Holding Pattern	(VGSI Angle 3.00/TCH 57).

$$\begin{array}{r} 6000 \\ 3000 \end{array}$$
$$\frac{\text{GP } 3.04^\circ}{\text{TCH } 59}$$


GLIPP

NM to
V02

IM _____

- 3.6 NM -

CATEGORY		A	B	C	D
LPV	DA	772-3/4		339 (400-3/4)	
LNAY/ VNAV	DA	886-7/8		453 (500-7/8)	
LNAY	MDA	900-3/4 467 (500-3/4)		900-1 467 (500-1)	
CIRCLING		900-1 467 (500-1)	920-1 487 (500-1)	960-1 1/2 527 (600-1 1/2)	1080-2 647 (700-2)

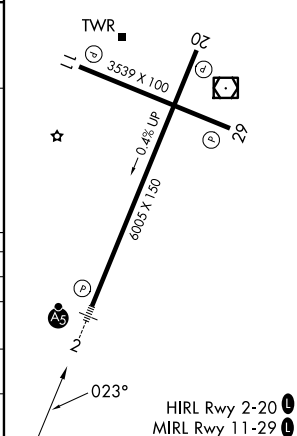

HIRL Rwy 2-20 **L**
MIRL Rwy 11-29 **L**

JACKSON, TENNESSEE

Orig-C 19MAY22

35°36'N-88°55'W

JACKSON RGNI (MKL)

RNAV (GPS) RWY 2