


VOR RWY 17
BRUCE CAMPBELL FLD (MBO)


T Rwy 17 helicopter visibility reduction below 1 SM NA. When local altimeter setting not received, use Jackson-Medgar Wiley Evers Intl altimeter setting and increase all MDA 40 feet, and Circling Cats C/D $\frac{1}{4}$ SM. Straight-in Rwy 17 NA at night, Circling Rwy 17 NA at night.

MISSED APPROACH: Climbing left turn to 3000 on MHZ VORTAC R-134 to RAKIN INT/MHZ 16.5 DME.

AWOS-3PT 119.125	JACKSON APP CON ★ 123.9 317.7	CLNC DEL 125.9	UNICOM 122.8 (CTAF) 0
----------------------------	---	--------------------------	---------------------------------

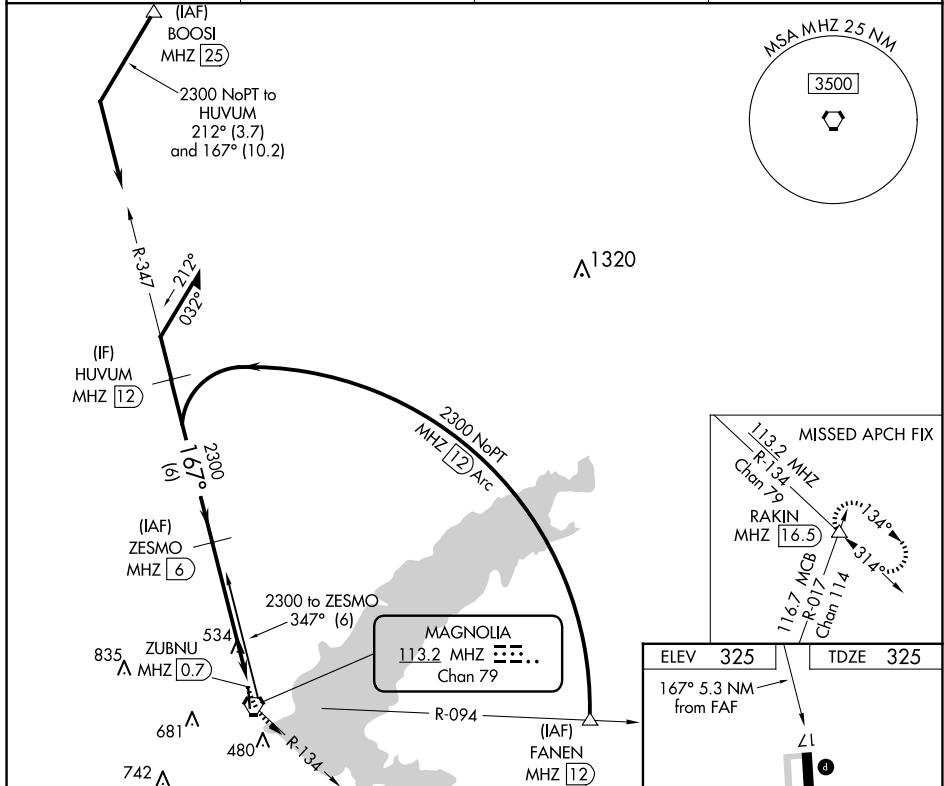

Remain within 10 NM	VGSI and descent angles not coincident (VGSI Angle 3.00/TCH 38). ZESMO MHZ	3000 MHZ R-134	RAKIN △
---------------------	--	----------------------	------------

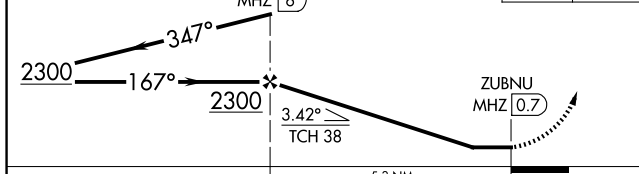

CATEGORY	A	B	C	D
S-17	800-1 475 (500-1)		800-1 $\frac{3}{8}$ 475 (500-1 $\frac{3}{8}$)	
 CIRCLING	820-1 495 (500-1)	840-1 515 (600-1)	1040-2 715 (800-2)	1040-2 $\frac{1}{4}$ 715 (800-2 $\frac{1}{4}$)

