

LOC I-TIW
109.1

APP CRS
167°

Rwy Ldg
5002
TDZE
294
Apt Elev
295


ILS or LOC RWY 17
TACOMA NARROWS (TIW)

⚠ When control tower closed, obtain local altimeter setting on UNICOM, when not received, use McCord Fld altimeter setting minimums.
Circling not authorized east of Rwy 17-35.

MALSR

MISSED APPROACH: Climb to 1500, then climbing right turn to 2000 via heading 290° and SEA VORTAC R-227 to SCENN INT and hold.

ATIS 124.05	SEATTLE APP CON 120.1 290.9	TACOMA TOWER★ 118.5 (CTAF) 0 253.5	GND CON 121.8	UNICOM 122.95
----------------	--------------------------------	---------------------------------------	------------------	------------------

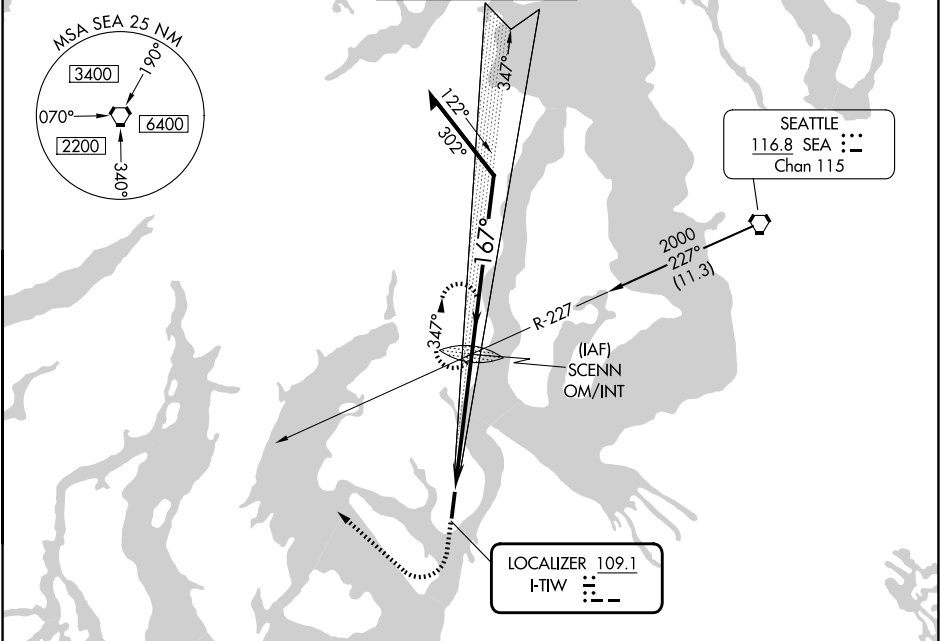

ELEV 295

TDZE 294

167°

45

35

5002 X 100

TWR

REIL Rwy 35

MIRL Rwy 17-35

FAF to MAP 5 NM

Knots	60	90	120	150	180
Min:Sec	5:00	3:20	2:30	2:00	1:40

1500

2000

hdg 290°

SEA R-227

SCENN INT

SCENN OM/INT

1964

347°

167°

2000

2000

5 NM

Remain within 10 NM

GS 3.00°

TCH 52

CATEGORY	A	B	C	D
S-ILS 17	494-1½ 200 (200-½)			
S-LOC 17	760-½ 466 (500-½)		760-¾ 466 (500-¾)	760-1 466 (500-1)
CIRCLING	760-1 465 (500-1)		820-1½ 525 (600-1½)	860-2 565 (600-2)
MCCHORD FLD ALTIMETER SETTING MINIMUMS				
S-ILS 17	519-½ 225 (300-½)			
S-LOC 17	780-½ 486 (500-½)		780-¾ 486 (500-¾)	780-1 486 (500-1)
CIRCLING	800-1 505 (600-1)		860-1½ 565 (600-1½)	900-2 605 (700-2)