
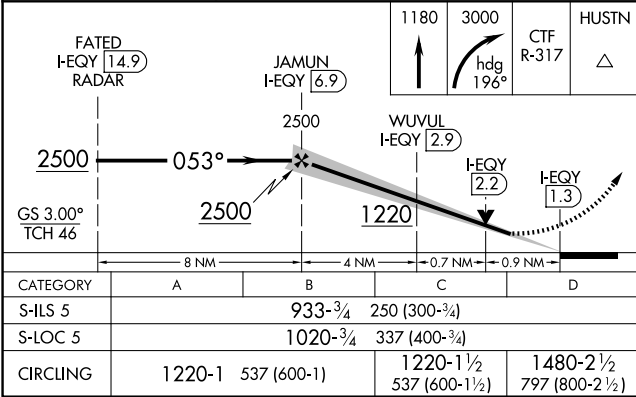


LOC/DME I-EQY 109.75 Chan 34 (Y)	APP CRS 053°	Rwy Ldg TDZE 683 Apt Elev 683	7001
--	------------------------	---	-------------

ILS or LOC RWY 5
CHARLOTTE/MONROE EXEC (EQY)

DME required. RADAR required for procedure entry.		MALSR 	MISSED APPROACH: Climb to 1180 then climbing right turn to 3000 on heading 196° and CTF VOR/DME R-317 to HUSTN/CTF 20.5 DME and hold, continue climb-in-hold to 3000.
ASOS 135.775	CHARLOTTE APP CON 120.05 307.8	CLNC DEL 132.55	UNICOM 122.7 (CTAF)

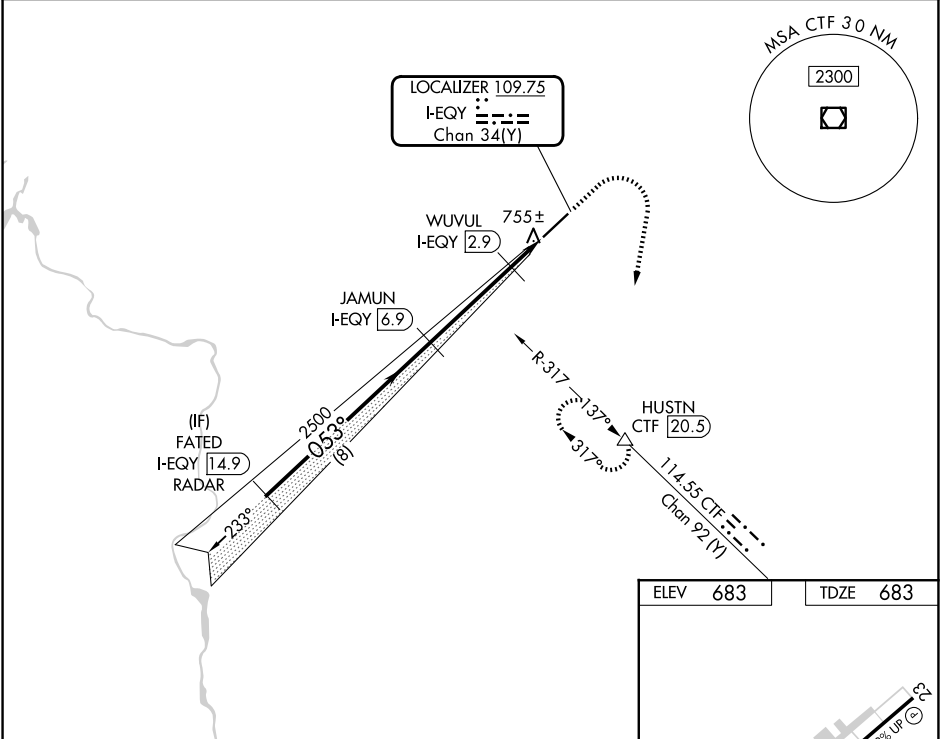

ELEV	683	TDZE	683
CATEGORY	A	B	C
S-ILS 5	933-3/4	250 (300-3/4)	
S-LOC 5	1020-3/4	337 (400-3/4)	
CIRCLING	1220-1	537 (600-1)	1220-1 1/2
			537 (600-1 1/2)
			797 (800-2 1/2)
HIRL Rwy 5-23			
REIL Rwy 23			
FAF to MAP 5.6 NM			
Knots	60	90	120
Min:Sec	5:35	3:44	2:48