

23054

ILS RWY 5R (CAT II)  
RICKENBACKER INTL (LCK)

**MISSED APPROACH:** Climb to 1500 then climbing right turn to 3000 direct XUB VOR and hold.

**ANA**



ALTERNATE  
MISSED APCH FIX  
COBBS  
DD =::  
253

I-DDV 7.2

Remain  
within 10 NM

DD LOM  
I-DDV 7.2

1500

3000

XUB

3000  $\swarrow$  232°  
 $\searrow$  052°  
 GS 3.00° TCH 54 25

VGSI and ILS glidepath not coincident  
(VGSI Angle 3.00/TCH 69).

IM

CATEGORY

A

B

C


D

S-ILS 5R

RA 100/12 100 DA 836

## CATEGORY II ILS - SPECIAL AIRCREW & AIRCRAFT CERTIFICATION REQUIRED

|      |     |          |      |     |
|------|-----|----------|------|-----|
| ELEV | 744 | <b>D</b> | TDZE | 736 |
|------|-----|----------|------|-----|

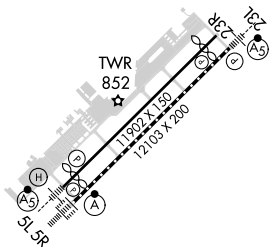

TDZ/CL Rwy 5R

REIL Rwy 23R

HIRL Rwyys 5L-23R and 5R-23L

RICKENBACKER INTL (LCK)  
ILS RWY 5R (CAT II)

EC-2, 27 NOV 2025 to 25 DEC 2025