

DENVER, COLORADO

AL-9077 (FAA)

25275

|                                        |                        |                                                                  |
|----------------------------------------|------------------------|------------------------------------------------------------------|
| WAAS<br>CH <b>82228</b><br><b>W08A</b> | APP CRS<br><b>082°</b> | Rwy Ldg <b>12000</b><br>TDZE <b>5354</b><br>Apt Elev <b>5434</b> |
|----------------------------------------|------------------------|------------------------------------------------------------------|

RNAV (GPS) Y RWY 8  
DENVER INTL (DEN)

▼ For uncompensated Baro-VNAV systems, LNAV/VNAV NA below -25°C (-13°F) or above 47°C (117°F). Simultaneous approach authorized with Rwy 7. DME/DME RNP-0.3 NA. LNAV procedure NA during simultaneous operations. Use of FD or AP providing RNAV track guidance required during simultaneous operations. For inoperative MALSR, increase LNAV Cat C/D visibility to RVR 5500. # RVR 1800 authorized with use of FD or AP or HUD to DA.



MALSR



**MISSED APPROACH:** Climb to 10000 direct KVERN and on track 041° to WITNE and hold.

|                              |                                                                     |                                       |                                                                 |
|------------------------------|---------------------------------------------------------------------|---------------------------------------|-----------------------------------------------------------------|
| D-ATIS<br><b>125.6 379.9</b> | DENVER APP CON<br><b>119.3 307.3 (N)</b><br><b>120.35 379.3 (S)</b> | DENVER TOWER<br><b>132.35 239.275</b> | GND CON<br><b>121.35 379.175 (W)</b><br><b>121.85 377.1 (E)</b> |
|------------------------------|---------------------------------------------------------------------|---------------------------------------|-----------------------------------------------------------------|



MISSED APCH FIX

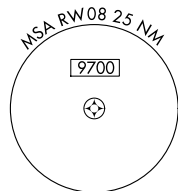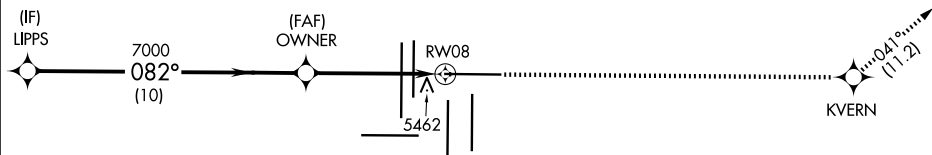


## RADAR REQUIRED

|           |          |           |
|-----------|----------|-----------|
| ELEV 5434 | <b>D</b> | TDZE 5354 |
|-----------|----------|-----------|

VGSI and RNAV glidepath not coincident  
(VGSI Angle 3.00/TCH 70).

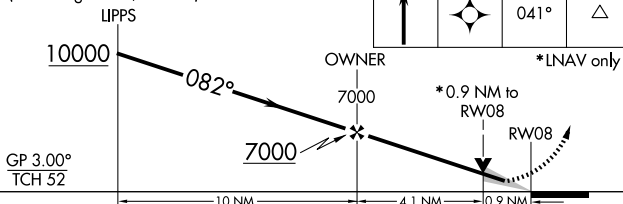

| CATEGORY         | A                    | B | C                   | D |
|------------------|----------------------|---|---------------------|---|
| LPV DA #         | 5554/24 200 (200-½)  |   |                     |   |
| LNAV/<br>VNAV DA | 5833/60 479 (400-1¼) |   |                     |   |
| LNAV MDA         | 5720/24 366 (300-½)  |   | 5720/35 366 (300-⅝) |   |

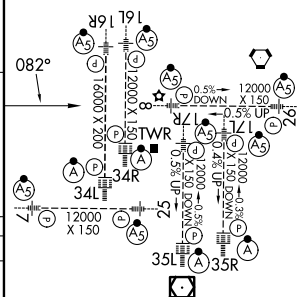

HIRL all Rwy's  
TDZ/CL Rwy's 7, 16L, 16R, 17R,  
26, 34L, 34R, 35L, 35R

DENVER, COLORADO

Amdt 1C 07DEC17

39°52'N-104°40'W

DENVER INTL (DEN)

RNAV (GPS) Y RWY 8

SW-1, 27 NOV 2025 to 25 DEC 2025