

25331

ILS or LOC RWY 36L
ORLANDO INTL (MCO)

MISSED APPROACH: Climb to 500 then climbing left turn to 3000 on heading 340° and ORL VORTAC R-248 to DNMR/ORL 6 DME and hold, continue climb-in-hold 3000.

Simultaneous approach authorized.

ALTERNATE MISSED APCH FIX

CAMBE LAL (29)

116.0 LAL Chan 107

046

226°

R-046

ORLANDO 112.2 ORL Chan 59

DNMOR ORL (6)


068°

2.48

R-248

Orlando Exec

LOCALIZER 111.9 I-MCO

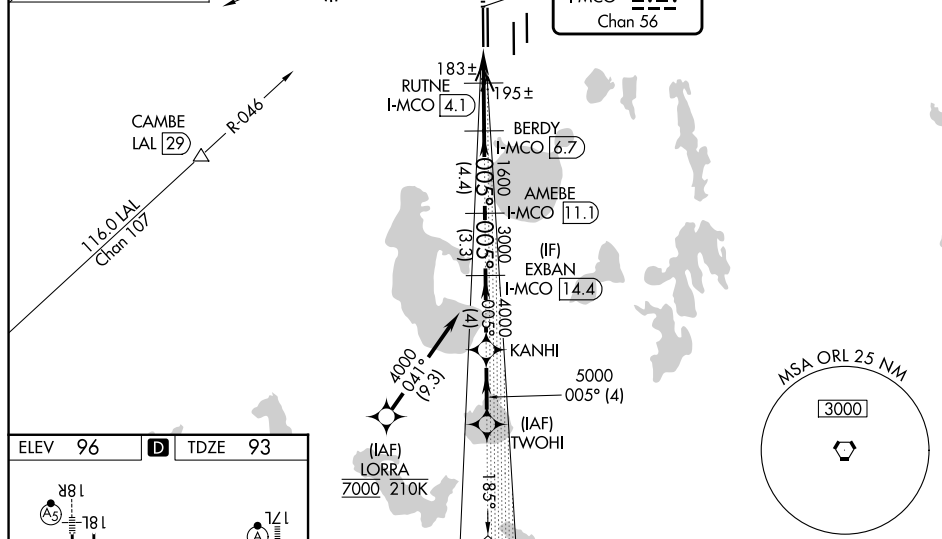

120.4 X 200
120.5 X 200
36L
36R
005°

TWR

35L
35R
36R

17L/R
18R
35L/R
36R

HIRL all Rwy
REIL Rwy 36L
TDZ/CL Rwy 17L/R,
18R, 35L/R and 36R

CATEGORY	A	B	C	D
S-ILS 36L	293/40	200 (200-3/4)		
S-LOC 36L	440/55	347 (400-1)		
CIRCLING	740-1 644 (700-1)	740-1 3/4 644 (700-1 3/4)	740-2 644 (700-2)	

ORLANDO INTL (MCO)
ILS or LOC RWY 36L

SE-3, 25 DEC 2025 to 22 JAN 2026