

ILS or LOC/DME RWY 28

LOC I-SYA 110.1	APCH CRS 287°	Rwy Idg 10,004 TDZE 93 Arpt Elev 98
---------------------------	-------------------------	--


[USAF]

EARECKSON AS (SYA) (PASY)

* Circling not authorized N of Rwy 10-28.	SALS 	MISSED APPROACH: Climb to 600, then climbing left turn to 3000 direct FOMDA and hold.
---	----------	---

ANCHORAGE CENTER 119.1 339.8	CTAF 127.2 352.05
--	-----------------------------

CAUTION: Numerous obstructions in area N of Rwy 10-28.
Missed approach requires use of RNAV or ATC RADAR monitoring.

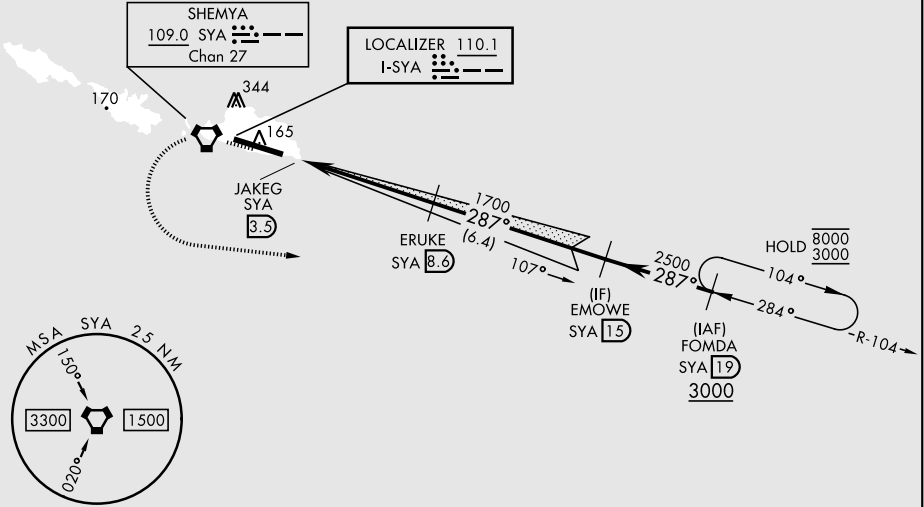

EMERG SAFE ALT 100 NM 5400

600		3000	FOMDA SYA 19	VGSi and ILS glidepath not coincident (VGSi Angle 2.50/TCH 46).		FOMDA SYA 19	ELEV 98	TDZE 93			
CATEGORY		A		B		C		D		E	
S-ILS 28				293-1		200		(200-1)			
S-LOC 28				460-1		367		(400-1)			
CIRCLING*		460-1 362 (400-1)		560-1 462 (500-1)		560-1½ 465 (500-1½)		660-2 562 (600-2)		680-2 582 (600-2)	
HIRL Rwy 10-28 REIL Rwy 10 and 28											

ILS or LOC/DME RWY 28

AK, 27 NOV 2025 to 22 JAN 2026

AK, 27 NOV 2025 to 22 JAN 2026